

## City of Alexandria Storm Sewer Capacity Analysis (CASSCA)

### Cameron Run Condition Assessment

**PREPARED FOR:** City of Alexandria, CH2M Hill

**PREPARED BY:** Michael Baker Jr., Inc.

**DATE:** November 4, 2014 (Revised May 26, 2015)

### Introduction

As part of the City of Alexandria CASSCA project, a visual inspection of the storm sewer structures within Cameron Run was completed. In total, 302 storm sewer structures were inspected. This included 117 manholes, 145 inlets, 3 catch basins, 27 I/O structures, 9 culvert points, and one control device. In addition, 548 storm sewer pipe segments were inspected. This Technical Memorandum summarizes the results of the field investigations in the Cameron Run watershed.

The inspections were performed by Video Pipe Services (VPS) using the “Lamping” technique. Lamping involves the use of a pole-mounted optical zoom camera to visually assess the condition of the buried infrastructure. The lamping method is an unconfined space inspection procedure that does not require entry into a manhole. The use of an optical zoom camera allows field crews to remain at ground level of a storm structure and screen the structure and its connecting pipes for defects. The lamping technique is a preliminary inspection tool to assess the condition of buried infrastructure and determine if further investigation or repair is warranted. In addition to visually inspecting the stormwater structures and pipes, field crews from VPS obtained the size and invert measurements of storm pipes.

Closed-Circuit Television (CCTV) pipe inspections were also conducted in Cameron Run for the corrugated metal pipe (CMP) segments. The number of CMP segments represents a small fraction (less than 1%) of the total storm infrastructure length in Cameron Run watershed. The results of the condition assessment of the CMP inspections will be provided in a separate memorandum.

The storm sewer structures and pipes were inspected utilizing the Pipeline Assessment and Certification Program (PACP©) coding standards developed by the National Association of Sewer Service Companies, and were assessed further using the Sewer Condition Risk Evaluation Algorithm Model (SCREAM™). In addition to visually inspecting the storm structures and pipes, field crews from VPS also obtained the size and invert measurements of storm pipes. The data collected from the field work was logged into a database using the *SCREAM Manhole and Lamping Inspection Field Tool*, revised August 2011 (Revision 6) and included as Appendix B in the *CASSCA Field Investigation Manual* delivered to the City of Alexandria in August 2011.

SCREAM is a system of assessment algorithms and tables that synthesizes data produced from asset inspection methods such as CCTV, zoom camera lamping, smoke & dye testing, sonar, laser profiling, manhole and catch basin visual inspections. Each structure or pipe segment was assigned a score according to the visual inspection results. The SCREAM scoring system produces scores for the overall asset condition, and also for the categories of Structural, Maintenance and I/I group defects for each asset. A scoring scale of 1 to 100 for each defect is automatically assigned when the operator enters the defect code. A score of 1 represents a very minor defect and a score of 100 represents the most severe defect. To represent the overall condition of a pipe or MH, an overall score is derived from the scores of the individual defects utilizing the SCREAM program.

The following defect categories as shown in Table 1 have been established in SCREAM for different conditions of sewer facilities along with corresponding ranges for each defect category. Note that the examples provided are meant to show a typical defect found in an asset that would result in the condition category rating.


**Table 1 – SCREAM Defect Categories**

Defect Category	Score Range	Example
<b>None</b>	0	n/a
<b>Few</b>	1-20	Infiltration weeper
<b>Minimum</b>	21-40	Manhole cracks less than 1/8"
<b>Moderate</b>	41-60	Spalling of chamber wall, large infiltration flow
<b>Major</b>	61-80	Large cracks in cover or frame
<b>Extreme</b>	81-100	Collapsed Pipe

## Structure Inspections

As part of this inspection task, 302 storm structures were inspected in the Cameron Run watershed. Figure 1 shows the number of structures within each defect category identified in the previous section. Figure 2 shows the geographic location of each structure within the Cameron Run watershed, color coded to its defect category. The average condition score of the storm structures was 37 (Minimum defect category). The largest defect group was the major category (scores 61-80), with about eight (8) percent of the structures. About 48 percent of Cameron Run structures ranked in the minimum, few defect categories or lower (scores 0-40). Approximately 44 percent of the Cameron Run structures were rated 41-60 (Moderate). None of the inspected Cameron Run structures were ranked in the extreme category. The highest structure score was 72.

There were 75 structures for which inspections were partially conducted at the surface only (manhole lid is locked, bolted, or jammed) or not conducted at all (structure could not be found in the field). Note that these structures are not included in Figure 1 or Figure 2. Appendix C: Summary of Structures Not Inspected provides a breakdown of the reasons why these manholes were not inspected.

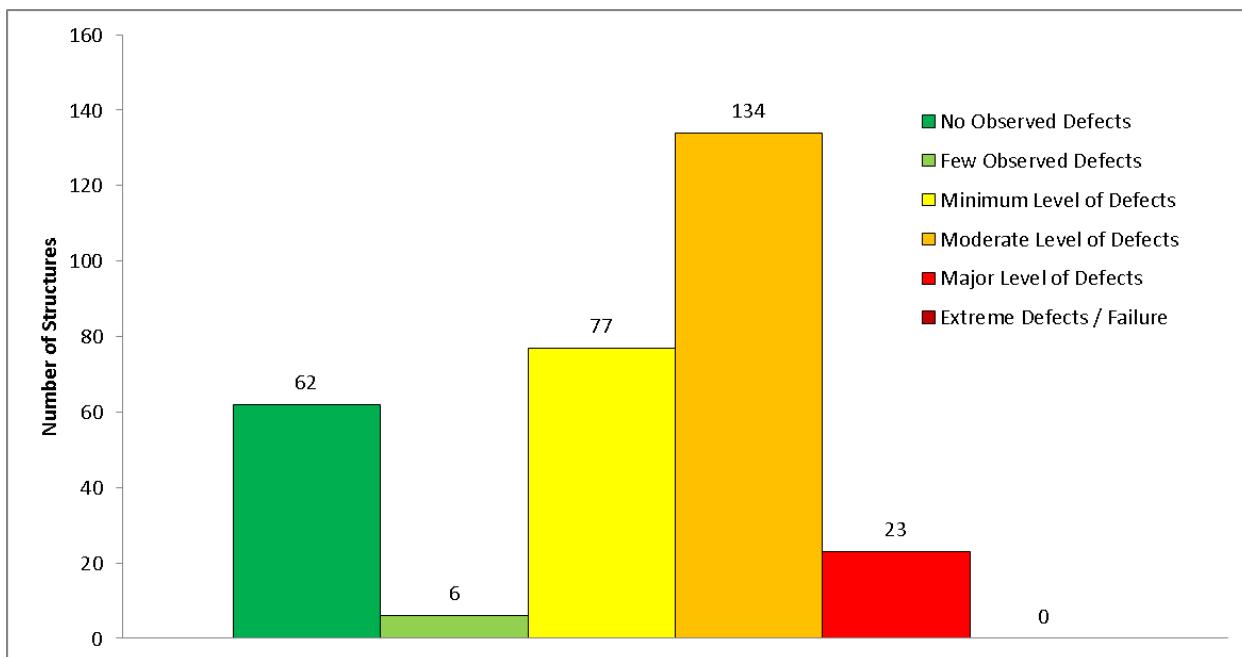

**Figure 1. Structure Inspections Summary.**

**Figure 2. Overall Condition of Storm Structures (Color coded by Severity of Defects).**


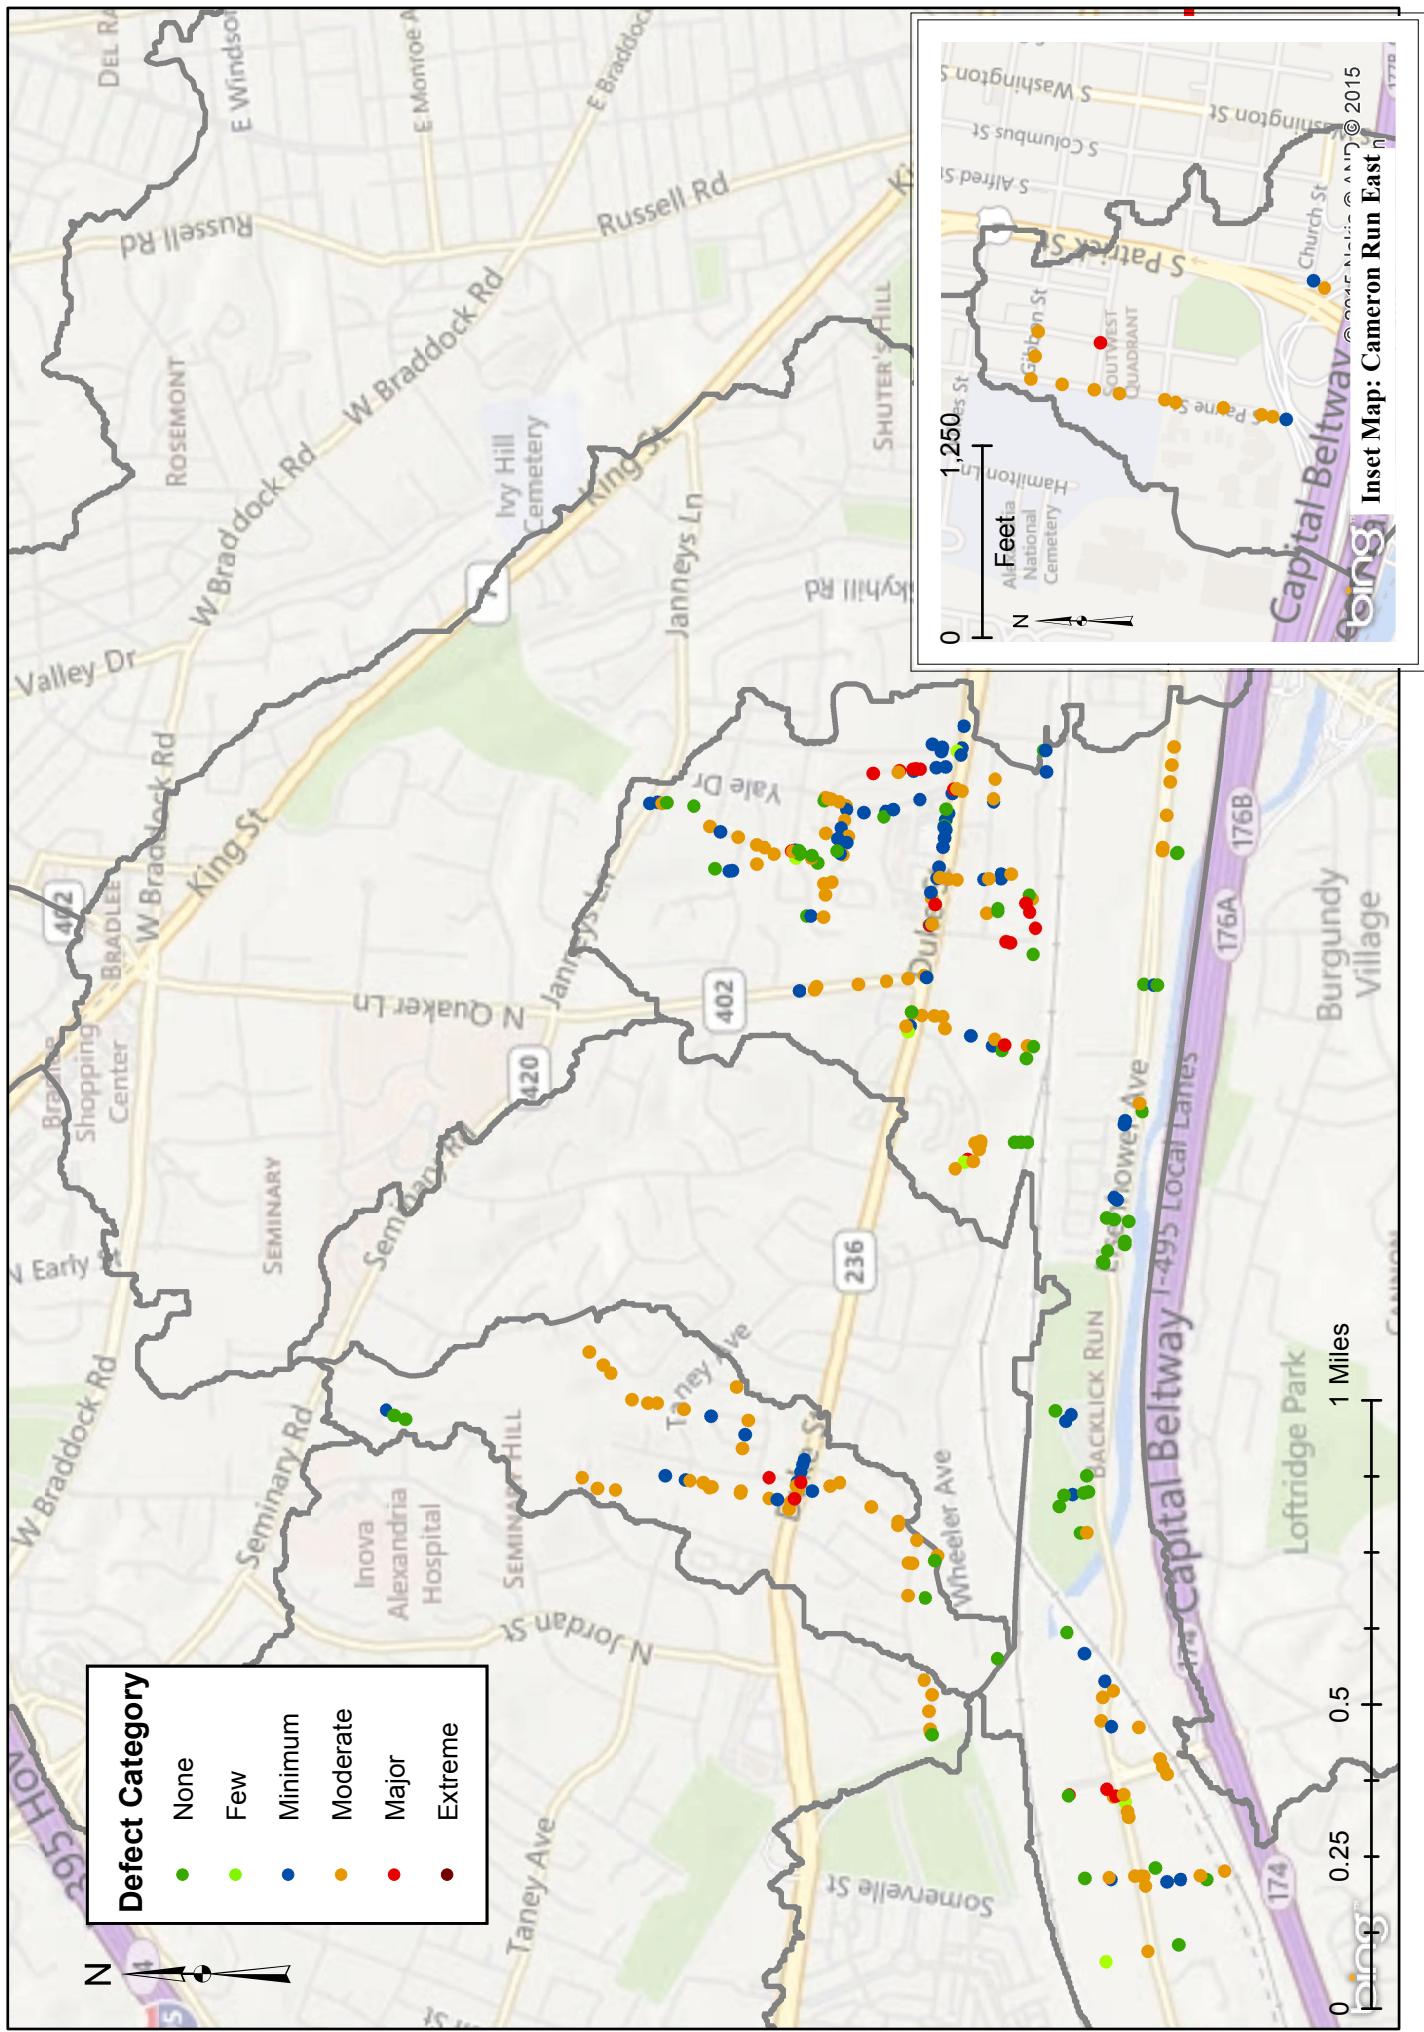


Figure 3 displays the location of the structures classified with major damage only. Extreme damage was not observed within the Cameron Run watershed. Most structures with high defect scores are observed along Duke Street in the center subwatershed of the Cameron Run watershed. For further detailed condition assessment, the inspection results of the structures were broken down by structure component. Table 2 lists the number of observed defects by component and severity. Note that the table shows a count of the number of defects found in each component and their respective severity across all structures, not the number of inspections performed. Multiple defects may be found in a single component of a structure.

**Table 2 - Count of Structure Inspection Observations by MH Component and Severity**

Structure Component	Min	Mod	Maj	Extreme
Cover	1	1	-	-
Frame	4	4	4	-
Frame Base Seal	177	24	2	-
Grade Ring	7	-	-	-
Chimney/Shaft	232	3	-	-
Chamber	606	29	1	-
Bench	40	12	-	4
Channel	44	9	2	7
Pipe Connection	28	1	2	1

**Figure 3. Location of Storm Structures in the "Major" and "Extreme" Categories (Color coded by Severity of Defects).**

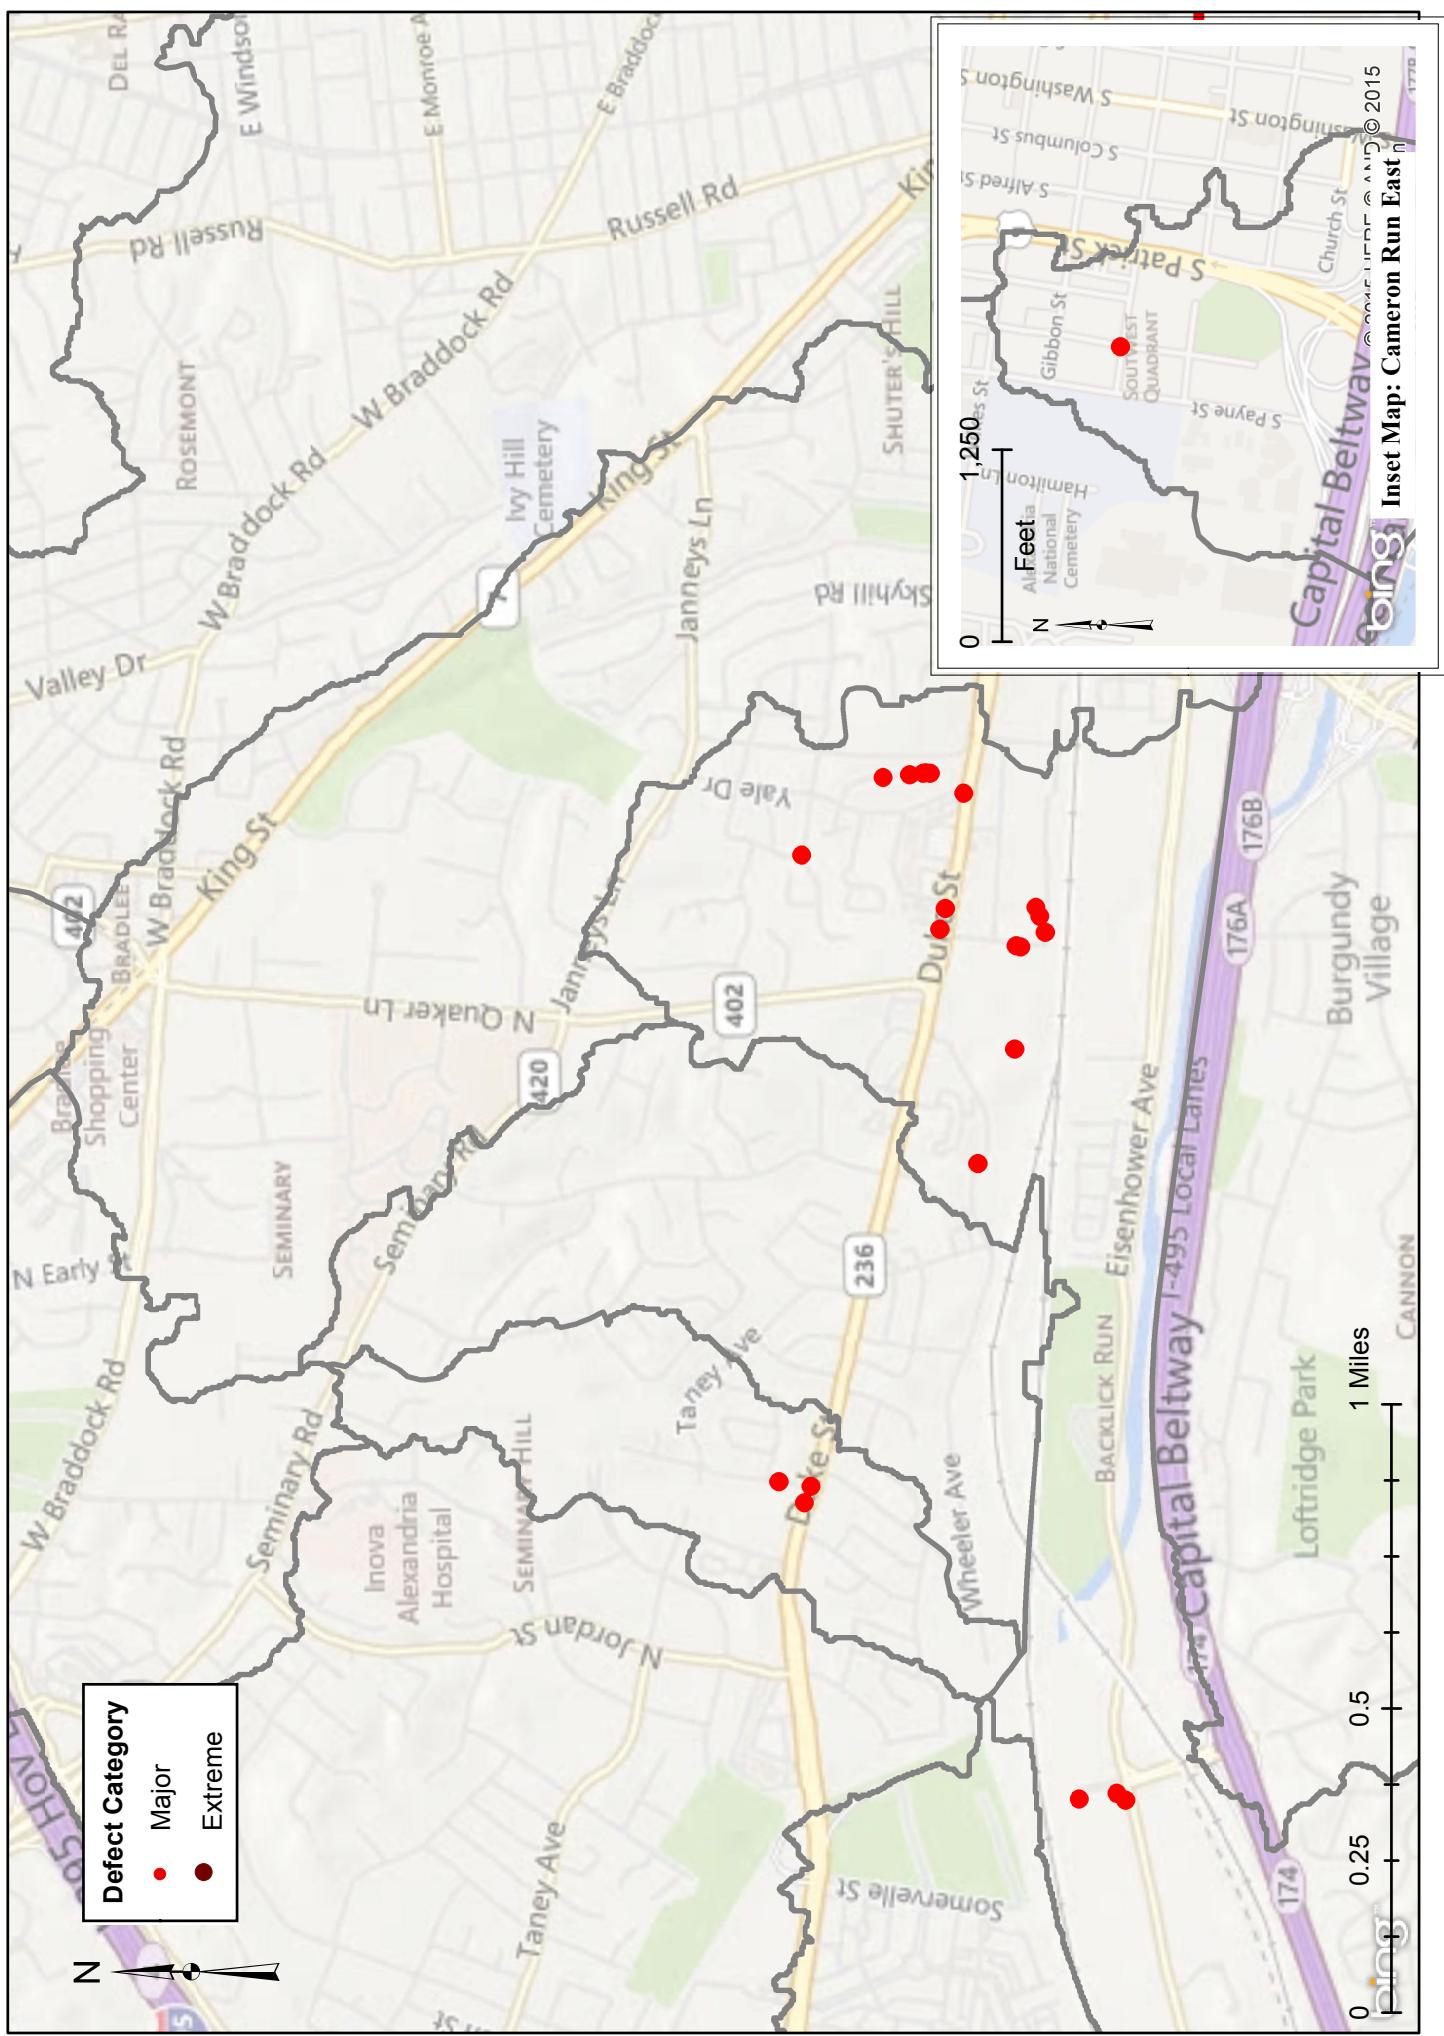

Observed defects of lower severity (Minimum and Moderate defect categories) were frequently associated with the frame base seal, chimney, chamber, channel, bench, and pipe connection components. Eleven (11) instances or occurrences of major damage were observed in the Cameron Run structures, and twelve (12) extreme damage occurrences were recorded. The covers of the inspected structures were in good condition, with only two (2) documented damage points in the minimum and moderate categories.

The majority of problems found in the structures were associated with the chamber areas. There were over 600 instances of minimum-severity defects in the chambers of the inspected structures, and 29 moderate-severity defects in the chambers. Cracks in the chamber between 1/16" to 1/8" in width, for example, are considered moderate damage. Corroded, pitted or spalled portions of a structure are also considered damage; for example, 10-25% of material loss classifies the damage as moderate. Figure 4 and 5 are examples of moderate damage to the chamber walls.



**Figure 4. Moderate Damage to Chamber Wall in Structure 001162IN  
(Overall SCREAM Score = 50).**



**Figure 5. Moderate Damage to Chamber Wall in Structure 001496IN  
(Overall SCREAM Score = 50).**

Examples of problems in the major category for the frame base seal, and frame are shown in Figures 6 and 7, respectively.



**Figure 6. Major Frame Base Seal Damage on Structure 000485SMH  
(Overall SCREAM Score = 64).**



**Figure 7. Major Frame Offset on Structure 000221IN  
(Overall SCREAM Score = 50).**

The problems in the component extreme category were associated with the manhole channel (7 instances), bench (4 instances), and pipe connections (1 instance). Generally, this involved either large amounts of settled debris (more than about five gallons), large cracks in the concrete (larger than  $\frac{1}{4}$  inch), or spalling and etching (25% to 50% material loss). Infiltration associated with the cracks (inflow higher than about 10 gpm) is also ranked in the extreme category of defects. Figures 8 and 9 are examples of problems in the extreme category in manhole channels. Figure 10 depicts an extreme example of a manhole pipe connection problem.



**Figure 8. Heavy Debris in Structure 002451IN  
(Overall SCREAM Score = 69).**



**Figure 9. Heavy Debris in Structure 000059CB  
(Overall SCREAM Score = 69).**



**Figure 10. Infiltration at Pipe Connection in Structure 000856SMH  
(Overall SCREAM Score = 61).**

Appendix A: Structure Inspection Summary provides a summary of the total SCREAM defect score of each storm structure, and Appendix B: Structure Inspection Report provides a detailed report of the defects associated with each inspection.

## Pipeline Inspections

In total, 548 storm sewer pipe segments were inspected in the Cameron Run watershed. Figure 11 shows the number of pipe segments within each defect category. Figure 12 shows a map of the location of each inspected pipeline, color coded by the defect categories identified previously in the memorandum. The average condition score of the storm pipe segments inspected within the Cameron Run watershed was 1.3 (few). Inspection results in Cameron Run showed that the pipe segments were observed to be in generally good condition, with no defect observed in 95% of the pipes.


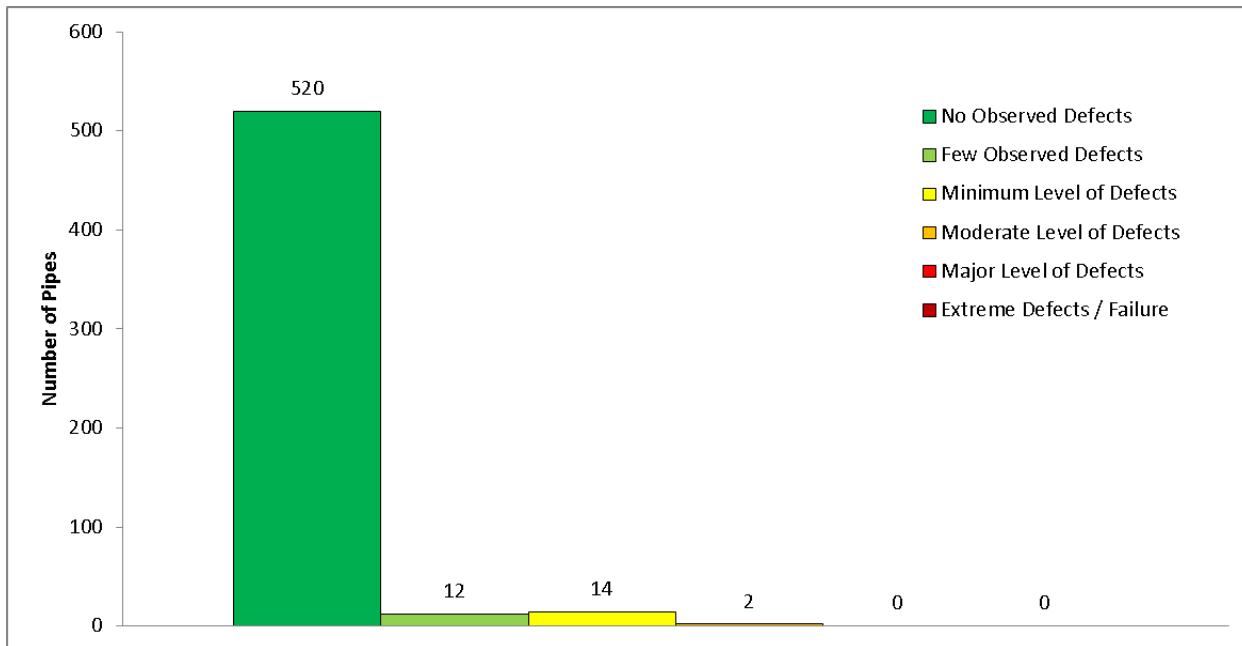


Figure 11. Pipe Lamping Inspections Summary.


Figure 12. Overall Condition of Storm Pipelines (Color coded by Severity of Defects).

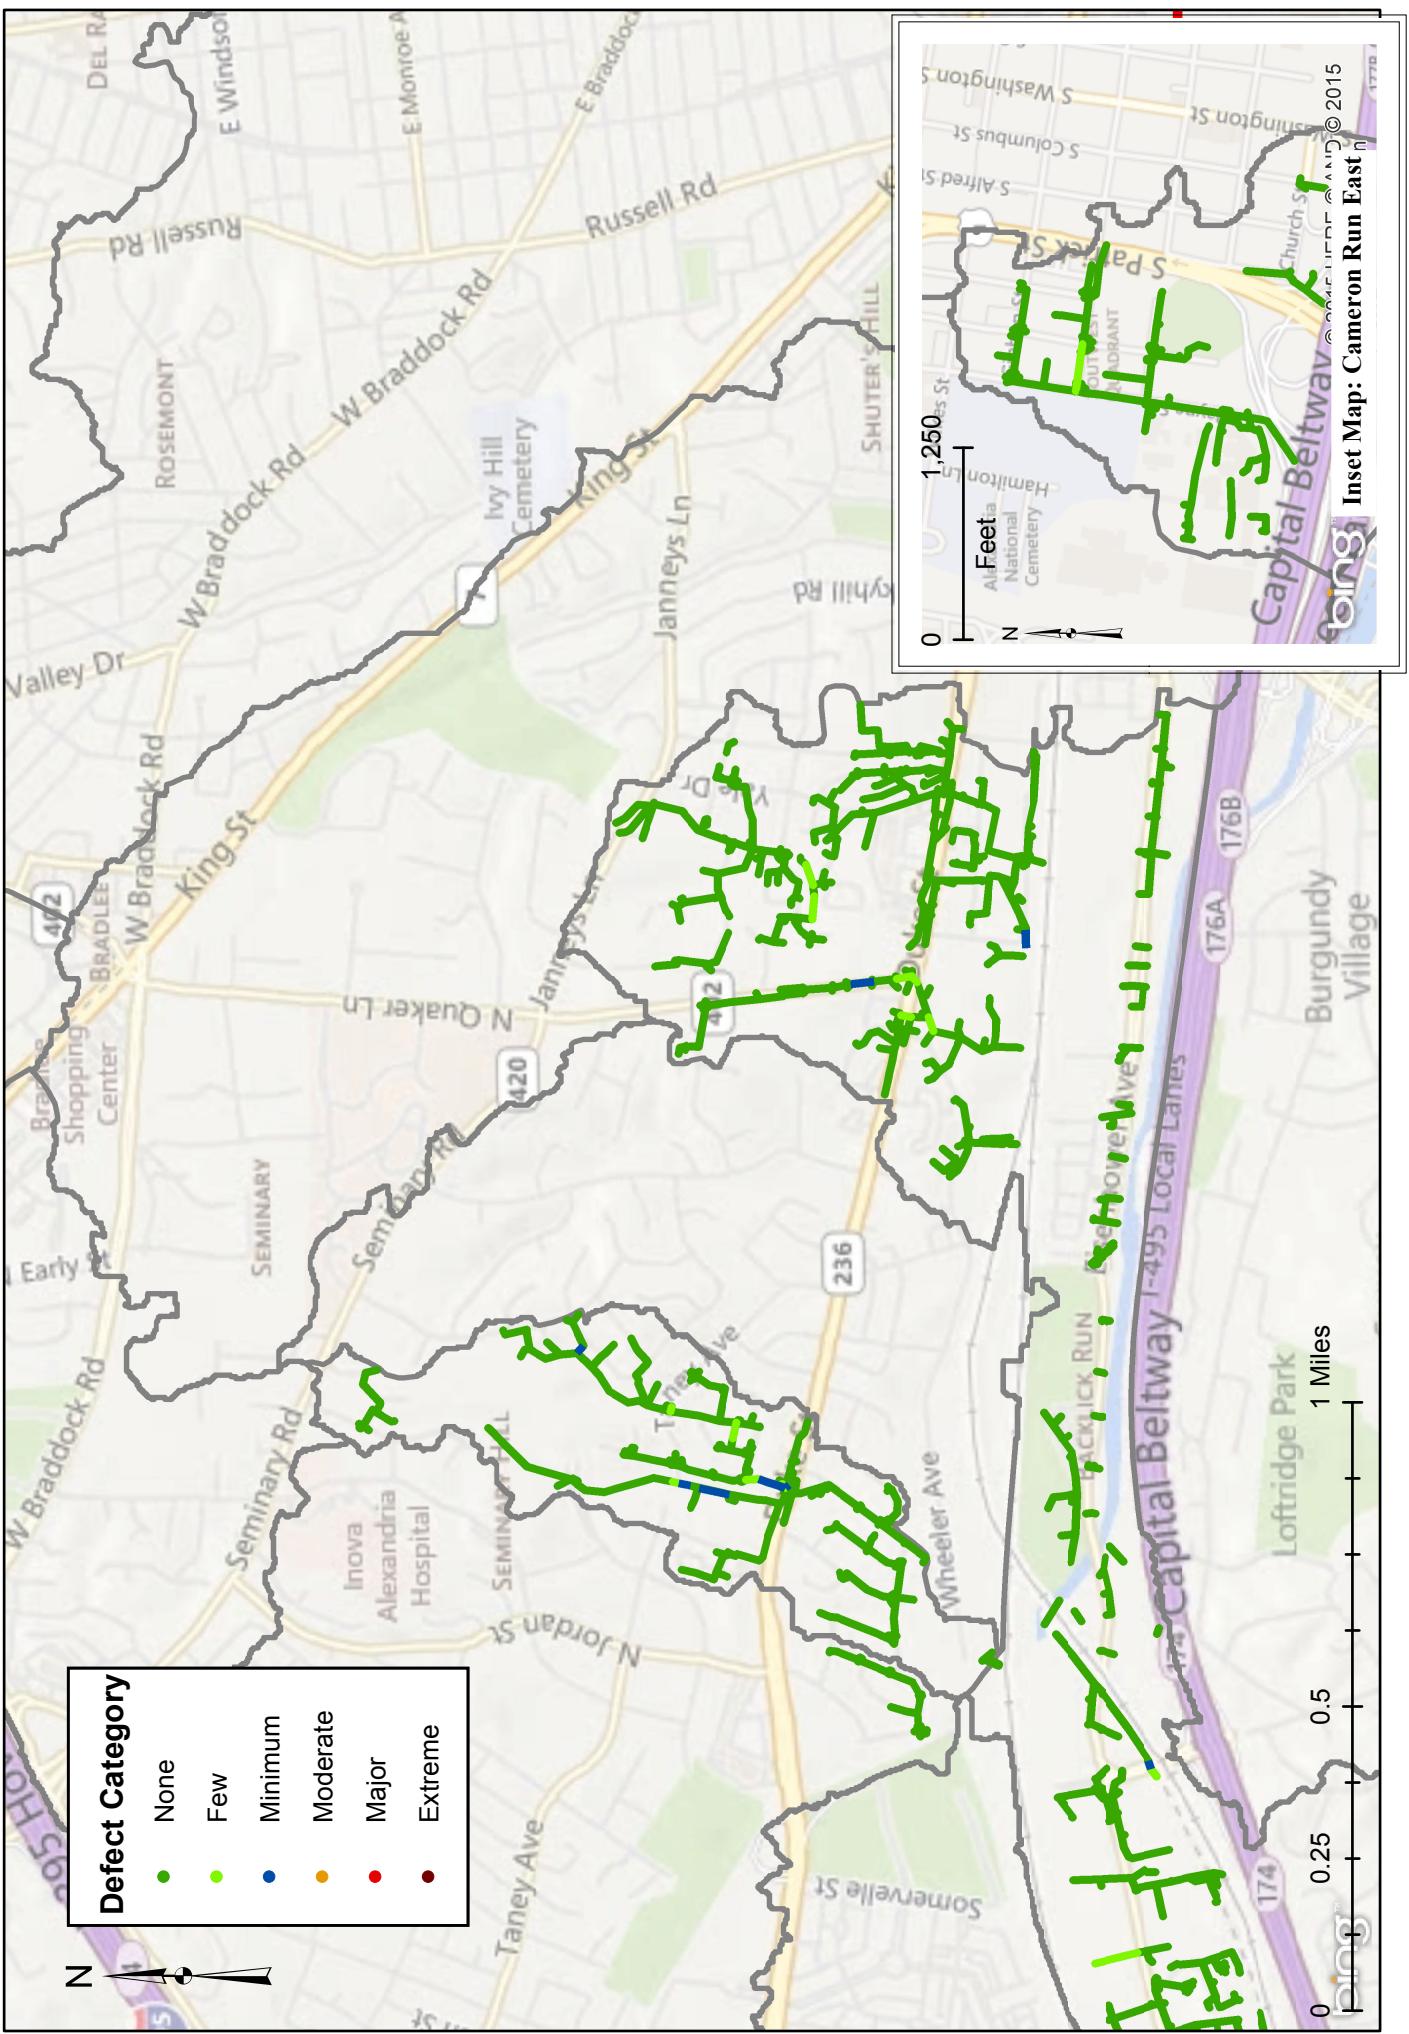


The following images captured during the lamping inspections show typical defects observed within Cameron Run storm pipes. Figures 13 and 14 show examples of structural damage, both with multiple long cracks throughout the storm pipe. The 18-inch diameter segment in Figure 13 and the 36-inch diameter segment in Figure 14 both had overall SCREAM scores of 40 (minimum). Figure 15 is an example of an open joint in a 21-inch pipe with a SCREAM score of 30 (minimum). Figure 16 shows evidence of infiltration inside a 66-inch pipe placing it in the few observed defects category with a SCREAM score of 20.

The highest overall SCREAM score among the inspected Cameron Run pipe segments was 45. There were no pipe segments with overall SCREAM scores in the major or extreme score categories.

Appendix D: Summary of Observed Pipe Defects lists each inspected pipe with a defect, the nature of the problem(s), and the SCREAM total score.

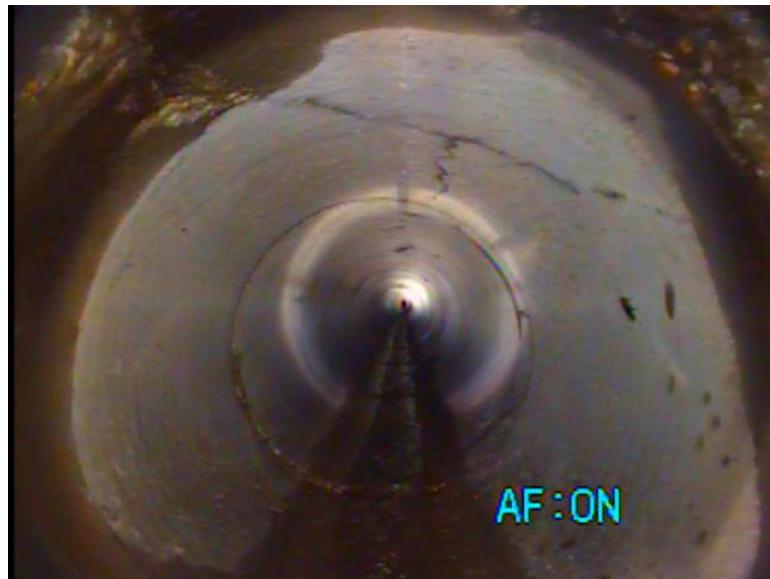

**Figure 13. Multiple Cracks in 18-in Storm Pipe between Structures 000853SMH and 000854SMH  
(Overall SCREAM Score = 40).**

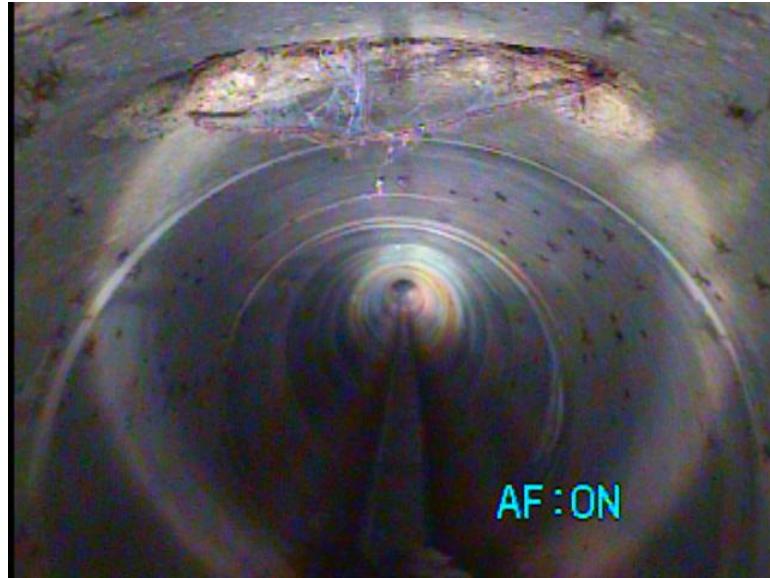

**Figure 14. Multiple Cracks in 36-in Storm Pipe between Structures 001495IN and 001500IN  
(Overall SCREAM Score = 40).**



**Figure 15. Open Joint in 21-in Storm Pipe between Structures 003626IN and 003624IN  
(Overall SCREAM Score = 30).**



**Figure 16. Infiltration in 66-in Storm Pipe between Structures 001175SMH and 000230IO  
(Overall SCREAM Score = 20).**

## Summary

In total, 302 storm sewer structures and 548 associated pipeline segments were visually inspected for defects and damage using the lamping technique. The average SCREAM condition score for the storm structures was 37 (minimum) and the average condition score for pipe segments was 1.3 (few). None manholes inspected had observed defects in the extreme category (scores 81-100). There were no pipe segments with overall SCREAM scores in the major or extreme score categories.

**Appendix A – Structure Inspection Summary**

**(Sorted by Defect Score)**



# SCREAM™ Manhole and Lamp Post Inspection Status List

Sorted by Total MH Score

Alexandria - Cameron Run

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000846SMH	X	116	S QUAKER LA	Light Highway Rural Streets	03/28/2014	Truck 1	Complete Inspection	72	51	50	0	3
Cameron Run	000848SMH	X	116	S QUAKER LA	Parking Lot	03/28/2014	Truck 1	Complete Inspection	72	51	50	0	4
Cameron Run	000849SMH	X	3200	COLVIN ST	Parking Lot	03/28/2014	Truck 1	Complete Inspection	72	51	50	0	5
Cameron Run	001179SMH	X	4601	EISENHOWER AV	Parking Lot	09/11/2013	Truck 1	Complete Inspection	72	73	0	0	3
Cameron Run	000059CB	X	3260	DUKE ST	Yard-Front	03/21/2014	Truck 1	Complete Inspection	69	38	59	0	1
Cameron Run	000794SMH	X	170	CAMBRIDGE RD	Light Highway Rural Streets	09/03/2013	Truck 1	Complete Inspection	69	70	5	0	3
Cameron Run	002451IN	X	100	S QUAKER LA	Parking Lot	03/28/2014	Truck 1	Complete Inspection	69	38	59	0	1
Cameron Run	002452IN	X	116	S QUAKER LA	Parking Lot	03/28/2014	Truck 1	Complete Inspection	69	38	59	0	3
Cameron Run	002473IN	X	3240	DUKE ST	Sidewalk	03/21/2014	Truck 1	Complete Inspection	69	38	59	0	1
Cameron Run	000797SMH	X	138	CAMBRIDGE RD	Light Highway Rural Streets	09/03/2013	Truck 1	Complete Inspection	68	69	5	0	3
Cameron Run	000806SMH	X	3060	DUKE ST	Sidewalk	03/06/2014	Truck 1	Complete Inspection	66	67	0	0	4
Cameron Run	000597SMH	X	4213	DUKE ST	Light Highway Rural Streets	03/06/2014	Truck 1	Complete Inspection	65	66	0	0	2
Cameron Run	000798SMH	X	138	CAMBRIDGE RD	Light Highway Rural Streets	09/03/2013	Truck 1	Complete Inspection	65	66	0	0	3
Cameron Run	000485SMH	X	301	PRINCETON BV	Sidewalk	08/26/2013	Truck 1	Complete Inspection	64	64	0	0	3
Cameron Run	000799SMH	X	136	CAMBRIDGE RD	Light Highway Rural Streets	09/03/2013	Truck 1	Complete Inspection	64	64	5	0	3
Cameron Run	000465SMH	X	4231	DUKE ST	Light Highway Rural Streets	03/06/2014	Truck 1	Complete Inspection	63	63	15	0	2
Cameron Run	000795SMH	X	199	ELLSWORTH ST	Light Highway Rural Streets	09/03/2013	Truck 1	Complete Inspection	63	65	0	0	4
Cameron Run	001178SMH	X	4601	EISENHOWER AV	Parking Lot	09/11/2013	Truck 1	Complete Inspection	62	62	5	0	3
Cameron Run	000088SMH	X	631	S FAYETTE ST	Light Highway Rural Streets	04/23/2014	Truck 1	Complete Inspection	61	62	0	0	3
Cameron Run	000456SMH	X	90	N GORDON ST	Light Highway Rural Streets	03/06/2014	Truck 1	Complete Inspection	61	61	0	0	2
Cameron Run	000856SMH	X	3518	WHEELER AV	Parking Lot	03/28/2014	Truck 1	Complete Inspection	61	63	0	0	4
Cameron Run	001177SMH	X	4601	EISENHOWER AV	Sidewalk	09/11/2013	Truck 1	Complete Inspection	61	62	0	0	5
Cameron Run	001846IN	X	3649	WHEELER AV	Sidewalk	09/03/2013	Truck 1	Complete Inspection	61	62	0	0	4
Cameron Run	000457SMH	X	4231	DUKE ST	Light Highway Rural Streets	03/06/2014	Truck 1	Complete Inspection	60	61	0	0	5
Cameron Run	001176SMH	X	4601	EISENHOWER AV	Parking Lot	09/11/2013	Truck 1	Complete Inspection	60	60	5	0	2
Cameron Run	000064SMH	X	630	S PAYNE ST	Light Highway Rural Streets	04/23/2014	Truck 1	Complete Inspection	59	60	0	0	4
Cameron Run	000618SMH	X	3649	WHEELER AV	Sidewalk	09/03/2013	Truck 1	Complete Inspection	59	58	15	0	2
Cameron Run	000684SMH	X	4306	VERMONT AV	Light Highway Rural Streets	02/28/2014	Truck 1	Complete Inspection	59	60	0	0	3
Cameron Run	000685SMH	X	4313	VERMONT AV	Light Highway Rural Streets	02/28/2014	Truck 1	Complete Inspection	59	61	0	0	4
Cameron Run	000692SMH	X	4400	VERMONT AV	Light Highway Rural Streets	02/28/2014	Truck 1	Complete Inspection	59	60	0	0	4
Cameron Run	000840SMH	X	11	N QUAKER LA	Light Highway Rural Streets	04/23/2014	Truck 1	Complete Inspection	59	60	0	0	5
Cameron Run	000857SMH	X	3400	DUKE ST	Parking Lot	03/28/2014	Truck 1	Complete Inspection	59	59	0	0	4
Cameron Run	002483IN	X	3200	COLVIN ST	Parking Lot	03/28/2014	Truck 1	Complete Inspection	59	38	43	0	1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000462SMH	X	320	N JORDAN ST	Yard-Front	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	58	59	0	0	2
Cameron Run	000466SMH	X	4233	DUKE ST	Yard-Back	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	58	59	0	0	3
Cameron Run	000705SMH	X	215	S JENKINS ST	Light Highway Rural Streets	<a href="#">03/21/2014</a>	Truck 1	Complete Inspection	58	57	17	0	2
Cameron Run	001380IN	X	1000	ST STEPHENS RD	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	58	60	0	0	3
Cameron Run	003667IN	X	4740	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	58	58	0	0	3
Cameron Run	000454SMH	X	116	N GRAYSON ST	Light Highway Rural Streets	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	57	58	0	0	5
Cameron Run	000464SMH	X	4231	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	57	58	0	0	3
Cameron Run	000479SMH	X	302	PRINCETON BV	Sidewalk	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	57	58	0	0	4
Cameron Run	000854SMH	X	51	ARELL CT	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	57	58	0	0	4
Cameron Run	000860SMH	X	3400	DUKE ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	57	58	0	0	4
Cameron Run	000063SMH	X	614	S PAYNE ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	3
Cameron Run	000065SMH	X	1222	FRANKLIN ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	3
Cameron Run	000066SMH	X	732	S PAYNE ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	4
Cameron Run	000068SMH	X	732	S PAYNE ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	3
Cameron Run	000076SMH	X	910	S PAYNE ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	3
Cameron Run	000445SMH	X	112	N GLADDEN ST	Light Highway Rural Streets	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	56	57	0	0	3
Cameron Run	000458SMH	X	4231	DUKE ST	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	56	58	0	0	4
Cameron Run	000638SMH	X	45	S GORDON ST	Light Highway Rural Streets	<a href="#">03/05/2014</a>	Truck 1	Complete Inspection	56	57	0	0	3
Cameron Run	000675SMH	X	4227	VERMONT AV	Light Highway Rural Streets	<a href="#">03/05/2014</a>	Truck 1	Complete Inspection	56	57	0	0	4
Cameron Run	000706SMH	X	225	S JENKINS ST	Light Highway Rural Streets	<a href="#">03/21/2014</a>	Truck 1	Complete Inspection	56	57	0	0	4
Cameron Run	000707SMH	X	233	S JENKINS ST	Light Highway Rural Streets	<a href="#">03/21/2014</a>	Truck 1	Complete Inspection	56	57	0	0	3
Cameron Run	000709SMH	X	4501	HOLMES RUN PY	Light Highway Rural Streets	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	56	57	0	0	4
Cameron Run	000838SMH	X	3260	DUKE ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	2
Cameron Run	000844SMH	X	3060	DUKE ST	Sidewalk	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	5
Cameron Run	000850SMH	X	201	N QUAKER LA	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	4
Cameron Run	000851SMH	X	210	N QUAKER LA	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	3
Cameron Run	000853SMH	X	101	N QUAKER LA	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	4
Cameron Run	000855SMH	X	11	N QUAKER LA	Light Highway Rural Streets	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	56	57	0	0	4
Cameron Run	000870SMH	X	1202	DARTMOUTH RD	Yard-Back	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	56	57	0	0	2
Cameron Run	000461SMH	X	320	N JORDAN ST	Parking Lot	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	55	56	0	0	4
Cameron Run	003669IN	X	4701	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	55	52	15	0	3
Cameron Run	001180SMH	X	4351	EISENHOWER AV	Light Highway Rural Streets	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	54	55	0	0	3
Cameron Run	001210SMH	X	2850	EISENHOWER AV	Light Highway Rural Streets	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	54	55	0	0	4
Cameron Run	000489SMH	X	303	PRINCETON BV	Light Highway Rural Streets	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	53	54	0	0	4
Cameron Run	000621SMH	X	3649	WHEELER AV	Sidewalk	<a href="#">09/03/2013</a>	Truck 1	Complete Inspection	53	54	0	0	3
Cameron Run	000622SMH	X		WHEELER AV	Parking Lot	<a href="#">09/03/2013</a>	Truck 1	Complete Inspection	53	54	0	0	3
Cameron Run	001501IN	X	4233	DUKE ST	Yard-Back	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	53	50	15	0	3
Cameron Run	009284IN	X		S PAYNE ST	Easement	<a href="#">04/23/2014</a>	Truck 1	Complete Inspection	53	54	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000463SMH	X	320	N JORDAN ST	Easement	03/06/2014	Truck 1	Complete Inspection	52	53	0	0	5
Cameron Run	000826SMH	X	3214	COLVIN ST	Light Highway Rural Streets	03/21/2014	Truck 1	Complete Inspection	52	51	5	0	3
Cameron Run	000842SMH	X	3106	COLVIN ST	Light Highway Rural Streets	03/28/2014	Truck 1	Complete Inspection	52	51	5	0	2
Cameron Run	001175SMH	X	4750	EISENHOWER AV	Parking Lot	04/18/2014	Truck 1	Complete Inspection	52	53	0	0	2
Cameron Run	000061SMH	X	600	S PAYNE ST	Light Highway Rural Streets	04/23/2014	Truck 1	Complete Inspection	51	52	0	0	3
Cameron Run	000062SMH	X	1221	GIBBON ST	Light Highway Rural Streets	04/23/2014	Truck 1	Complete Inspection	51	52	0	0	3
Cameron Run	000486SMH	X	301	PRINCETON BV	Light Highway Rural Streets	08/26/2013	Truck 1	Complete Inspection	51	52	0	0	2
Cameron Run	000796SMH	X	199	ELLSWORTH ST	Light Highway Rural Streets	09/03/2013	Truck 1	Complete Inspection	51	49	15	0	2
Cameron Run	001181SMH	X	4601	EISENHOWER AV	Light Highway Rural Streets	02/28/2014	Truck 1	Complete Inspection	51	52	0	0	4
Cameron Run	001500IN	X	212	N GORDON ST	Yard-Back	03/06/2014	Truck 1	Complete Inspection	51	51	0	0	3
Cameron Run	001506IN	X	4073	TANEY AV	Easement	03/06/2014	Truck 1	Complete Inspection	51	52	0	0	3
Cameron Run	002433IN	X	3026	COLVIN ST	Sidewalk	03/28/2014	Truck 1	Complete Inspection	51	52	0	0	3
Cameron Run	002450IN	X	3240	COLVIN ST	Sidewalk	03/21/2014	Truck 1	Complete Inspection	51	52	0	0	2
Cameron Run	000060SMH	X	1115	GIBBON ST	Light Highway Rural Streets	04/23/2014	Truck 1	Complete Inspection	50	51	0	0	4
Cameron Run	000064CB	X	3210	DUKE ST	Parking Lot	03/21/2014	Truck 1	Complete Inspection	50	50	0	0	2
Cameron Run	000069SMH	X	840	S PAYNE ST	Light Highway Rural Streets	04/23/2014	Truck 1	Complete Inspection	50	51	0	0	2
Cameron Run	000221IN	X	919	CHURCH ST	Easement	04/18/2014	Truck 1	Complete Inspection	50	50	0	0	3
Cameron Run	000436SMH	X	4070	TANEY AV	Easement	03/06/2014	Truck 1	Complete Inspection	50	51	0	0	3
Cameron Run	000459SMH	X	121	N FURMAN ST	Light Highway Rural Streets	03/06/2014	Truck 1	Complete Inspection	50	51	0	0	4
Cameron Run	000467SMH	X	4233	DUKE ST	Yard-Back	03/06/2014	Truck 1	Complete Inspection	50	50	0	0	2
Cameron Run	000619SMH	X	3640	WHEELER AV	Sidewalk	09/03/2013	Truck 1	Complete Inspection	50	51	0	0	3
Cameron Run	000836SMH	X	3060	DUKE ST	Main Highway Suburban	04/23/2014	Truck 1	Complete Inspection	50	51	0	0	3
Cameron Run	000841SMH	X	3210	DUKE ST	Driveway	03/21/2014	Truck 1	Complete Inspection	50	51	0	0	3
Cameron Run	000852SMH	X	202	N QUAKER LA	Light Highway Rural Streets	04/23/2014	Truck 1	Not Inspected - Not Opened	50	50	0		0
Cameron Run	000858SMH	X	3400	DUKE ST	Driveway	03/28/2014	Truck 1	Complete Inspection	50	51	0	0	3
Cameron Run	000907SMH	X	3208	COLVIN ST	Parking Lot	03/21/2014	Truck 1	Complete Inspection	50	51	0	0	2
Cameron Run	001155IN	X	309	PRINCETON BV	Sidewalk	08/26/2013	Truck 1	Complete Inspection	50	50	0	0	3
Cameron Run	001162IN	X	1111	TRINITY DR	Sidewalk	08/26/2013	Truck 1	Complete Inspection	50	50	0	0	3
Cameron Run	001193SMH	X	3801	EISENHOWER AV	Light Highway Rural Streets	04/18/2014	Truck 1	Complete Inspection	50	51	0	0	3
Cameron Run	001211SMH	X	2850	EISENHOWER AV	Light Highway Rural Streets	04/18/2014	Truck 1	Complete Inspection	50	51	0	0	3
Cameron Run	001212SMH	X	2930	EISENHOWER AV	Light Highway Rural Streets	04/18/2014	Truck 1	Complete Inspection	50	51	0	0	4
Cameron Run	001213SMH	X	2950	EISENHOWER AV	Light Highway Rural Streets	04/18/2014	Truck 1	Complete Inspection	50	51	0	0	4
Cameron Run	001214SMH	X	3000	EISENHOWER AV	Light Highway Rural Streets	04/18/2014	Truck 1	Complete Inspection	50	51	0	0	3
Cameron Run	001215SMH	X	3000	EISENHOWER AV	Light Highway Rural Streets	04/18/2014	Truck 1	Complete Inspection	50	51	0	0	5
Cameron Run	001381IN	X	4004	FT WORTH AV	Easement	03/06/2014	Truck 1	Complete Inspection	50	50	0	0	2
Cameron Run	001496IN	X		DUKE ST.	Sidewalk	03/06/2014	Truck 1	Complete Inspection	50	50	0	0	2
Cameron Run	002518IN	X	3518	WHEELER AV	Parking Lot	03/28/2014	Truck 1	Complete Inspection	50	51	0	0	5

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	003624IN	X	4536	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	50	51	0	0	2
Cameron Run	003674IN	X	4701	EISENHOWER AV	Sidewalk	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	50	50	0	0	2
Cameron Run	002522IN	X	3400	DUKE ST	Easement	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	49	50	0	0	3
Cameron Run	000676SMH	X	103	S GORDON ST	Light Highway Rural Streets	<a href="#">03/05/2014</a>	Truck 1	Complete Inspection	48	49	0	0	3
Cameron Run	000677SMH	X	113	S GORDON ST	Light Highway Rural Streets	<a href="#">03/05/2014</a>	Truck 1	Complete Inspection	48	49	0	0	3
Cameron Run	000678SMH	X	129	S GORDON ST	Light Highway Rural Streets	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	48	49	0	0	2
Cameron Run	001246IN	X	1102	JANNEYS LA	Curb/Gutter	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	48	49	0	0	3
Cameron Run	001840IN	X	3649	WHEELER AV	Sidewalk	<a href="#">09/03/2013</a>	Truck 1	Complete Inspection	48	49	0	0	3
Cameron Run	000710SMH	X	4501	HOLMES RUN PY	Sidewalk	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	47	48	0	0	3
Cameron Run	000861SMH	X	1	ARELL CT	Easement	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	47	43	15	0	3
Cameron Run	000868SMH	X	1223	QUAKER HILL DR	Yard-Back	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	47	48	0	0	2
Cameron Run	001182SMH	X	4101	EISENHOWER AV	Yard-Front	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	47	48	0	0	3
Cameron Run	003633IN	X	4600	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	47	48	0	0	4
Cameron Run	000810SMH	X	218	ELLSWORTH ST	Yard-Front	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	46	46	0	0	3
Cameron Run	001382IN	X	1000	ST STEPHENS RD	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	46	47	0	0	3
Cameron Run	001497IN	X	4233	DUKE ST	Yard-Back	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	46	46	0	0	3
Cameron Run	001883IN	X	4214	DUKE ST	Parking Lot	<a href="#">03/05/2014</a>	Truck 1	Complete Inspection	46	46	0	0	2
Cameron Run	002470IN	X	3210	DUKE ST	Sidewalk	<a href="#">03/21/2014</a>	Truck 1	Complete Inspection	46	38	25	0	4
Cameron Run	003627IN	X	4600	EISENHOWER AV	Easement	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	46	46	0	0	2
Cameron Run	000634SMH	X	4242	DUKE ST	Light Highway Rural Streets	<a href="#">03/05/2014</a>	Truck 1	Complete Inspection	45	46	0	0	2
Cameron Run	001186SMH	X	4700	EISENHOWER AV	Parking Lot	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	45	46	0	0	4
Cameron Run	001191IN	X	400	PRINCETON BV	Easement	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	45	46	0	0	2
Cameron Run	001434IN	X	4071	TANEY AV	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	45	46	0	0	2
Cameron Run	002471IN	X	3125	DUKE ST	Sidewalk	<a href="#">03/21/2014</a>	Truck 1	Complete Inspection	45	38	17	0	2
Cameron Run	003610IN	X	4451	EISENHOWER AV	Sidewalk	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	45	46	0	0	3
Cameron Run	003634IN	X	4600	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	45	46	0	0	3
Cameron Run	003659IN	X	4700	EISENHOWER AV	Easement	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	45	46	0	0	3
Cameron Run	001251IN	X	306	PRINCETON BV	Yard-Back	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	44	45	0	0	2
Cameron Run	001505IN	X	1000	ST STEPHENS RD	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	44	45	0	0	2
Cameron Run	003625IN	X	4536	EISENHOWER AV	Easement	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	44	45	0	0	2
Cameron Run	001189SMH	X	4701	EISENHOWER AV	Parking Lot	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	43	44	0	0	3
Cameron Run	000869SMH	X	1215	QUAKER HILL DR	Yard-Front	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	42	43	0	0	4
Cameron Run	001495IN	X	320	N JORDAN ST	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	42	43	0	0	2
Cameron Run	001498IN	X	112	N GORDON ST	Yard-Back	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	42	42	0	0	2
Cameron Run	001841IN	X	3640	WHEELER AV	Sidewalk	<a href="#">09/03/2013</a>	Truck 1	Complete Inspection	42	42	0	0	3
Cameron Run	002349IN	X	1235	QUAKER HILL DR	Yard-Back	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	42	43	0	0	2
Cameron Run	002350IN	X	1215	QUAKER HILL DR	Yard-Back	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	42	43	0	0	3
Cameron Run	002406IN	X	1101	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	42	42	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	002408IN	X	1101	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	42	42	0	0	2
Cameron Run	002409IN	X	1119	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	42	42	0	0	2
Cameron Run	002410IN	X	218	ELLSWORTH ST	Sidewalk	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	42	42	0	0	2
Cameron Run	002416IN	X	1140	QUAKER HILL CT	Parking Lot	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	42	42	0	0	2
Cameron Run	002418IN	X	1129	QUAKER HILL CT	Parking Lot	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	42	38	5	0	2
Cameron Run	002420IN	X	1139	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	42	42	0	0	2
Cameron Run	002424IN	X	1199	QUAKER HILL DR	Sidewalk	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	42	42	0	0	3
Cameron Run	002528IN	X	35	ARELL CT	Sidewalk	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	42	43	0	0	3
Cameron Run	003614IN	X	4351	EISENHOWER AV	Sidewalk	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	42	38	5	0	2
Cameron Run	003626IN	X	4536	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	42	38	5	0	2
Cameron Run	003668IN	X		EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	42	38	5	0	3
Cameron Run	002512IN	X	3540	WHEELER AV	Parking Lot	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	41	38	2	0	2
Cameron Run	000220IN	X	919	CHURCH ST	Easement	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	37	38	0	0	4
Cameron Run	000641SMH	X	4141	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	37	38	0	0	4
Cameron Run	000801SMH	X	126	CAMBRIDGE RD	Easement	<a href="#">09/03/2013</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	000809SMH	X	3023	DUKE ST	Light Highway Rural Streets	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	000811SMH	X	121	YALE DR	Driveway	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	000835SMH	X	3023	DUKE ST	Sidewalk	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	001181IN	X	301	PRINCETON BV	Sidewalk	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	001187SMH	X	4700	EISENHOWER AV	Parking Lot	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	001192IN	X	1205	TRINITY DR	Sidewalk	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	001195IN	X	1205	TRINITY DR	Sidewalk	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	37	38	0	0	4
Cameron Run	001243IN	X	1102	JANNEYS LA	Sidewalk	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	001481IN	X	4213	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	001493IN	X	4149	TANEY AV	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	001494IN	X	4149	TANEY AV	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	001884IN	X	4214	DUKE ST	Parking Lot	<a href="#">03/05/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	001901IN	X	4141	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	001902IN	X	4213	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002339IN	X	3518	WHEELER AV	Parking Lot	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	37	38	0	0	5
Cameron Run	002348IN	X	1238	DARTMOUTH RD	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	002375IN	X		CAMBRIDGE RD	Curb/Gutter	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002376IN	X	126	CAMBRIDGE RD	Sidewalk	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002384IN	X	199	YALE DR	Sidewalk	<a href="#">09/03/2013</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002388IN	X	57	YALE DR	Easement	<a href="#">09/03/2013</a>	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	002395IN	X	2944	DUKE ST	Curb/Gutter	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002398IN	X	3012	DUKE ST	Sidewalk	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	002403IN	X	101	YALE DR	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	37	38	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	002412IN	X	201	YALE DR	Sidewalk	03/06/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002414IN	X	125	YALE DR	Sidewalk	03/06/2014	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	002417IN	X	1139	QUAKER HILL CT	Parking Lot	08/26/2013	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002421IN	X	1139	QUAKER HILL CT	Sidewalk	08/26/2013	Truck 1	Complete Inspection	37	38	0	0	1
Cameron Run	002427IN	X	1199	QUAKER HILL DR	Sidewalk	08/26/2013	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002446IN	X	3209	COLVIN ST	Sidewalk	03/21/2014	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	002454IN	X	3100	DUKE ST	Driveway	03/06/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002458IN	X	3110	DUKE ST	Sidewalk	03/06/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002460IN	X	3110	DUKE ST	Parking Lot	03/06/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002461IN	X	3120	DUKE ST	Parking Lot	03/06/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002463IN	X	3120	DUKE ST	Parking Lot	03/21/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002464IN	X	3127	DUKE ST	Parking Lot	03/21/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002468IN	X	3208	DUKE ST	Parking Lot	03/21/2014	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	002469IN	X	3210	DUKE ST	Parking Lot	03/21/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002472IN	X	3125	DUKE ST	Sidewalk	03/21/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002474IN	X	3260	DUKE ST	Sidewalk	03/21/2014	Truck 1	Complete Inspection	37	38	0	0	4
Cameron Run	002507IN	X	3502	WHEELER AV	Parking Lot	03/28/2014	Truck 1	Complete Inspection	37	38	0	0	4
Cameron Run	002529IN	X	1	ARELL CT	Sidewalk	03/28/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	002838IN	X		ORLEANS PL	Sidewalk	03/06/2014	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	003540SMH	X	3000	BUSINESS CENTER DR	Light Highway Rural Streets	04/18/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	003613IN	X	4351	EISENHOWER AV	Sidewalk	02/28/2014	Truck 1	Complete Inspection	37	38	0	0	4
Cameron Run	003617IN	X	4536	EISENHOWER AV	Sidewalk	02/28/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	003654IN	X	4351	EISENHOWER AV	Easement	02/28/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	003656IN	X	4700	EISENHOWER AV	Parking Lot	02/28/2014	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	003675IN	X	4701	EISENHOWER AV	Parking Lot	02/28/2014	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	003716IN	X	4101	EISENHOWER AV	Driveway	03/06/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	003721IN	X	3801	EISENHOWER AV	Sidewalk	03/19/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	003722IN	X		EISENHOWER AV	Sidewalk	03/19/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	003726IN	X	3833	EISENHOWER AV	Sidewalk	03/19/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	003808IN	X	3640	EISENHOWER AV	Sidewalk	04/18/2014	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	004097SMH	X	4214	DUKE ST	Easement	03/06/2014	Truck 1	Complete Inspection	37	38	0	0	4
Cameron Run	004458IN	X	3208	COLVIN ST	Curb/Gutter	03/21/2014	Truck 1	Complete Inspection	37	38	0	0	3
Cameron Run	004459IN	X	3208	COLVIN ST	Curb/Gutter	03/21/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	008951IN	X	3000	BUSINESS CENTER DR	Curb/Gutter	04/18/2014	Truck 1	Complete Inspection	37	38	0	0	2
Cameron Run	009267IN	X		GLADDEN ST.	Yard-Side	03/06/2014	Truck 1	Complete Inspection	37	37	0	0	2
Cameron Run	002411IN	X	1140	QUAKER HILL CT	Sidewalk	08/26/2013	Truck 1	Complete Inspection	35	35	0	0	2
Cameron Run	002435IN	X	3106	COLVIN ST	Sidewalk	03/28/2014	Truck 1	Complete Inspection	35	0	35	0	3
Cameron Run	000447SMH	X	152	N GLADDEN ST	Light Highway Rural Streets	03/06/2014	Truck 1	Complete Inspection	29	29	0	0	2
Cameron Run	000500SMH	X	301	N QUAKER LA	Light Highway Rural Streets	04/23/2014	Truck 1	Complete Inspection	29	29	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000866SMH	X	11	N QUAKER LA	Light Highway Rural Streets	04/23/2014	Truck 1	Complete Inspection	29	29	0	0	2
Cameron Run	000170IO	X	1137	QUAKER HILL CT	Easement	08/26/2013	Truck 1	Complete Inspection	28	29	0	0	1
Cameron Run	000477SMH	X	1108	VASSAR RD	Light Highway Rural Streets	08/26/2013	Truck 1	Complete Inspection	28	29	0	0	2
Cameron Run	001244IN	X	1101	JANNEYS LA	Sidewalk	03/19/2014	Truck 1	Complete Inspection	28	29	0	0	3
Cameron Run	002456IN	X	3110	DUKE ST	Parking Lot	03/06/2014	Truck 1	Complete Inspection	28	29	0	0	3
Cameron Run	003695IN	X	4001	EISENHOWER AV	Parking Lot	03/06/2014	Truck 1	Complete Inspection	28	29	0	0	1
Cameron Run	003696IN	X	4001	EISENHOWER AV	Parking Lot	03/06/2014	Truck 1	Complete Inspection	28	29	0	0	2
Cameron Run	009266IN	X		DUKE ST.	Yard-Back	03/06/2014	Truck 1	Complete Inspection	28	29	0	0	2
Cameron Run	000793SMH	X	130	CAMBRIDGE RD	Easement	04/18/2014	Truck 1	Complete Inspection	26	26	0	0	2
Cameron Run	002419IN	X	1139	QUAKER HILL CT	Sidewalk	08/26/2013	Truck 1	Complete Inspection	26	26	0	0	2
Cameron Run	003717IN	X	3833	EISENHOWER AV	Sidewalk	03/19/2014	Truck 1	Complete Inspection	26	26	0	0	3
Cameron Run	000077SMH	X	910	S PAYNE ST	Easement	04/23/2014	Truck 1	Complete Inspection	22	22	0	0	2
Cameron Run	001849IN	X	3655	WHEELER AV	Sidewalk	09/03/2013	Truck 1	Complete Inspection	20	20	0	0	2
Cameron Run	003632IN	X	4600	EISENHOWER AV	Sidewalk	09/11/2013	Truck 1	Complete Inspection	20	20	0	0	2
Cameron Run	000805SMH	X	3023	DUKE ST	Easement	04/18/2014	Truck 1	Complete Inspection	15	15	0	0	2
Cameron Run	002536IN	X	3449	DUKE ST	Light Highway Rural Streets	03/28/2014	Truck 1	Complete Inspection	15	15	0	0	2
Cameron Run	000230IO	X	4875	EISENHOWER AV	Easement	04/18/2014	Truck 1	Complete Inspection	10	10	0	0	1
Cameron Run	001184IN	X		DARTMOUTH	Sidewalk	08/26/2013	Truck 1	Complete Inspection	5	5	0	0	3
Cameron Run	000008CD	X		EISENHOWER AV	Parking Lot	02/28/2014	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000019IO	X	919	CHURCH ST		04/18/2014	Truck 1	Not Inspected - Not found	0	0	0	0	0
Cameron Run	000031CP	X	3640	WHEELER AV	Easement	09/03/2013	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000032CP	X	3640	WHEELER AV	Easement	09/03/2013	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000040ND	X	601	S FAYETTE ST		04/23/2014	Truck 1	Not Inspected - No	0	0	0	0	0
Cameron Run	000041CP	X		WHEELER AV.	Easement	03/21/2014	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000042CP	X		WHEELER AV.	Easement	03/21/2014	Truck 1	Not Inspected - Not	0	0	0	0	1
Cameron Run	000042ND	X	910	S PAYNE ST		04/23/2014	Truck 1	Not Inspected - No	0	0	0	0	0
Cameron Run	000047ND	X	631	S FAYETTE ST		04/23/2014	Truck 1	Not Inspected - No	0	0	0	0	0
Cameron Run	000049ND	X	1222	FRANKLIN ST		04/23/2014	Truck 1	Not Inspected - No	0	0	0	0	0
Cameron Run	000052ND	X	600	S PAYNE ST		04/23/2014	Truck 1	Not Inspected - No	0	0	0	0	0
Cameron Run	000058CB	X	100	S QUAKER LA		03/28/2014	Truck 1	Not Inspected - Not found	0	0	0	0	0
Cameron Run	000061CP	X	3865	EISENHOWER AV	Easement	03/19/2014	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000062CP	X	3863	EISENHOWER AV	Easement	03/19/2014	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000063CP	X	3869	EISENHOWER AV	Easement	03/19/2014	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000064CP	X	3869	EISENHOWER AV	Easement	03/19/2014	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000065CB	X	3209	COLVIN ST	Parking Lot	03/21/2014	Truck 1	Not Inspected - Not	0	0	0	0	0
Cameron Run	000065CP	X	3801	EISENHOWER AV	Easement	03/19/2014	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000071CB	X	3849	EISENHOWER AV	Curb/Gutter	03/19/2014	Truck 1	Complete Inspection	0	0	0	0	0
Cameron Run	000098IO	X	1200	DARTMOUTH RD	Easement	08/26/2013	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000099IO	X	1200	DARTMOUTH RD	Easement	08/26/2013	Truck 1	Complete Inspection	0	0	0	0	1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000131IO	X	3640	WHEELER AV	Easement	<a href="#">09/03/2013</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000146IO	X	129	S GORDON ST	Easement	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000147IO	X	238	S JENKINS ST	Easement	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000159IO	X	4400	VERMONT AV	Easement	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000169IO	X	1129	QUAKER HILL CT		<a href="#">08/26/2013</a>	Truck 1	Not Inspected - Not found	0	0	0		1
Cameron Run	000171IO	X	1199	QUAKER HILL DR	Easement	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000173IO	X	3240	COLVIN ST	Easement	<a href="#">03/21/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000175IO	X	116	S QUAKER LA	Easement	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000177IO	X	1098	DARTMOUTH RD	Easement	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000178IO	X	4106	ORLEANS PL	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000192ND	X	309	PRINCETON BV		<a href="#">08/26/2013</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000195ND	X	303	PRINCETON BV		<a href="#">08/26/2013</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000196ND	X	301	PRINCETON BV		<a href="#">08/26/2013</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000197ND	X	303	PRINCETON BV		<a href="#">08/26/2013</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000202ND	X	400	PRINCETON BV		<a href="#">08/26/2013</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000206ND	X	303	PRINCETON BV		<a href="#">08/26/2013</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000222ND	X	4231	DUKE ST		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000229IO	X	4750	EISENHOWER AV	Easement	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000230CP	X	4400	WHEELER AV	Easement	<a href="#">03/21/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000231CP	X	4305	WHEELER AV	Easement	<a href="#">03/21/2014</a>	Truck 1	Not Inspected - Not	0	0	0		1
Cameron Run	000233IO	X	4601	EISENHOWER AV	Easement	<a href="#">09/11/2013</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000234ND	X	4242	DUKE ST	Light Highway Rural Streets	<a href="#">03/05/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000238IO	X	4001	EISENHOWER AV		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000239IO	X	4349	EISENHOWER AV	Easement	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000241IO	X	4720	EISENHOWER AV		<a href="#">09/11/2013</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000242IO	X	201	CLERMONT AV	Easement	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000245IO	X	4001	EISENHOWER AV	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000246IO	X	4101	EISENHOWER AV	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000248IO	X	3849	EISENHOWER AV	Easement	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000258IO	X	3640	EISENHOWER AV	Easement	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000275ND	X	4227	VERMONT AV	Light Highway Rural Streets	<a href="#">03/05/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000291ND	X	136	CAMBRIDGE RD		<a href="#">09/03/2013</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000292ND	X	3060	DUKE ST		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000293ND	X	57	YALE DR		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000294ND	X	101	YALE DR		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000295ND	X	101	YALE DR		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000296ND	X	131	YALE DR		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000297ND	X	1139	QUAKER HILL CT		<a href="#">08/26/2013</a>	Truck 1	Not Inspected - No	0	0	0		1
Cameron Run	000298ND	X	57	YALE DR		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000299ND	X	57	YALE DR		<a href="#">04/18/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000300ND	X	57	YALE DR		<a href="#">04/18/2014</a>	Truck 1	Not Inspected - No	0	0	0		1
Cameron Run	000302ND	X	116	S QUAKER LA		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000305ND	X	100	S QUAKER LA		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000309ND	X	3106	COLVIN ST		<a href="#">03/28/2014</a>	Truck 1	Not Inspected - No	0	0	0		1
Cameron Run	000312ND	X	99	ARELL CT		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000314ND	X	3100	BUSINESS CENTER DR E		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000315ND	X	3208	COLVIN ST		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000320ND	X	3400	DUKE ST		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		1
Cameron Run	000323ND	X	1	ARELL CT		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000346IO	X	3234	COLVIN ST	Easement	<a href="#">03/21/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000442SMH	X	105	N GORDON ST		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000443SMH	X	104	N GLADDEN ST		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000447ND	X	4750	EISENHOWER AV		<a href="#">04/18/2014</a>	Truck 1	Not Inspected - No	0	0	0		1
Cameron Run	000452ND	X	4451	EISENHOWER AV		<a href="#">02/28/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000453ND	X	4351	EISENHOWER AV		<a href="#">02/28/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000453SMH	X	100	N GORDON ST		<a href="#">03/07/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000461ND	X	3869	EISENHOWER AV		<a href="#">03/19/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000462ND	X	3869	EISENHOWER AV		<a href="#">03/19/2014</a>	Truck 1	Not Inspected - No	0	0	0		1
Cameron Run	000463ND	X	3869	EISENHOWER AV		<a href="#">03/19/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000464ND	X	4001	EISENHOWER AV		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000465ND	X	4001	EISENHOWER AV		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000466ND	X	4001	EISENHOWER AV		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000468SMH	X	124	N GRAYSON ST		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000469ND	X	3800	DOMINION MILL DR		<a href="#">03/19/2014</a>	Truck 1	Not Inspected - No	0	0	0		1
Cameron Run	000470ND	X	3801	EISENHOWER AV		<a href="#">03/19/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000470SMH	X	801	N HOWARD ST		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000471ND	X	3801	EISENHOWER AV		<a href="#">03/19/2014</a>	Truck 1	Not Inspected - No	0	0	0		1
Cameron Run	000472ND	X	4001	EISENHOWER AV		<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000480ND	X	2959	EISENHOWER AV		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		2
Cameron Run	000483ND	X	3697	EISENHOWER AV		<a href="#">04/18/2014</a>	Truck 1	Not Inspected - Unsafe	0	0	0		1
Cameron Run	000561ND	X	3210	DUKE ST		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000611IO	X	3000	EISENHOWER AV	Easement	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000612IO	X		EISENHOWER AV	Easement	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000613IO	X	3518	WHEELER AV	Easement	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000614IO	X		S Quaker Ln		<a href="#">05/20/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000615IO	X		S Quaker Ln		<a href="#">05/20/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	000656ND	X	1500	EISENHOWER AV		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000657ND	X	910	S PAYNE ST		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	000802SMH	X	57	YALE DR		<a href="#">09/03/2013</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000819SMH	X	3101	COLVIN ST		<a href="#">03/28/2014</a>	Truck 1	Not Inspected - Not	0	0	0		0
Cameron Run	000830SMH	X	57	YALE DR		<a href="#">09/03/2013</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000831SMH	X	3101	COLVIN ST		<a href="#">03/28/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000834SMH	X	116	S QUAKER LA		<a href="#">03/28/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000837SMH	X	3240	DUKE ST		<a href="#">04/23/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000867SMH	X	3518	WHEELER AV		<a href="#">03/28/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	000871SMH	X	35	ARELL CT	Easement	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	3
Cameron Run	001185IN	X	1200	DARTMOUTH RD	Easement	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	001190SMH	X	4101	EISENHOWER AV	Driveway	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	3
Cameron Run	001191SMH	X	4101	EISENHOWER AV	Driveway	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	3
Cameron Run	001192SMH	X	4101	EISENHOWER AV	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	001248IN	X	1102	JANNEYS LA	Yard-Front	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	001249IN	X	1105	VASSAR RD	Yard-Back	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	001250IN	X	1207	TRINITY DR	Yard-Back	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	001504IN	X	1000	ST STEPHENS RD	Easement	<a href="#">03/06/2014</a>	Truck 1	Not Inspected - No	0	0	0		0
Cameron Run	002347IN	X	1304	DARTMOUTH RD	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	002354IN	X	1201	QUAKER HILL DR	Yard-Back	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	002407IN	X	1101	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	002422IN	X	125	YALE DR	Parking Lot	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	002457IN	X	3110	DUKE ST	Driveway	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	002459IN	X	3110	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	3
Cameron Run	002484IN	X	3200	COLVIN ST	Parking Lot	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	1
Cameron Run	002515IN	X	3518	WHEELER AV	Easement	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	002519IN	X	3518	WHEELER AV	Easement	<a href="#">03/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	002520IN	X	3518	WHEELER AV		<a href="#">03/28/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	003653IN	X	4101	EISENHOWER AV	Yard-Front	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	003657IN	X		EISENHOWER AV	Parking Lot	<a href="#">02/28/2014</a>	Truck 1	Complete Inspection	0	0	0	0	4
Cameron Run	003689IN	X	3869	EISENHOWER AV	Yard-Side	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	003714IN	X	4101	EISENHOWER AV	Easement	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	003728IN	X	3849	EISENHOWER AV	Sidewalk	<a href="#">03/19/2014</a>	Truck 1	Complete Inspection	0	0	0	0	3
Cameron Run	003787IN	X	3697	EISENHOWER AV	Sidewalk	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	004123SMH	X		DUKE ST.		<a href="#">07/10/2014</a>	Truck 1	Complete Inspection	0	0	0	0	0
Cameron Run	004460IN	X	3100	BUSINESS CENTER DR E		<a href="#">03/28/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	004461IN	X	3200	COLVIN ST		<a href="#">03/28/2014</a>	Truck 1	Not Inspected - Not found	0	0	0		0
Cameron Run	008949IN	X	3000	BUSINESS CENTER DR	Sidewalk	<a href="#">04/18/2014</a>	Truck 1	Complete Inspection	0	0	0	0	2
Cameron Run	009268IN	X		ORLEANS PL	Yard-Back	<a href="#">03/06/2014</a>	Truck 1	Complete Inspection	0	0	0	0	3

**Appendix B – Structure Inspection Report**  
**(Includes Defect Detail)**



# SCREAM™ Manhole and Lamp Post Inspection Status List

Sorted by Facility ID

Alexandria - Cameron Run

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes																																																																																
Cameron Run	000008CD	X		EISENHOWER AV	Parking Lot	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		0	0	0		1																																																																																
Cameron Run	000019IO	X	919	CHURCH ST		<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1	Not found	0	0	0		0																																																																																
Cameron Run	000031CP	X	3640	WHEELER AV	Easement	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		0	0	0		1																																																																																
Cameron Run	000032CP	X	3640	WHEELER AV	Easement	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		0	0	0		1																																																																																
Cameron Run	000040ND	X	601	S FAYETTE ST		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0																																																																																
Cameron Run	000041CP	X		WHEELER AV.	Easement	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		0	0	0		1																																																																																
Cameron Run	000042CP	X		WHEELER AV.	Easement	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1	Not Opened	0	0	0		1																																																																																
Cameron Run	000042ND	X	910	S PAYNE ST		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0																																																																																
Cameron Run	000047ND	X	631	S FAYETTE ST		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0																																																																																
Cameron Run	000049ND	X	1222	FRANKLIN ST		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0																																																																																
Cameron Run	000052ND	X	600	S PAYNE ST		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0																																																																																
Cameron Run	000058CB	X	100	S QUAKER LA		<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1	Not found	0	0	0		0																																																																																
Cameron Run	000059CB	X	3260	DUKE ST	Yard-Front	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		69	38	59		1																																																																																
<table border="1"> <tr> <td>Chamber</td><td>I/I evidence</td><td>Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr> <tr> <td>Chamber</td><td>Corroded, pitted, spalled</td><td>Min: &lt;10% mat'l loss, etching</td><td>Structural</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr> <tr> <td>Chamber</td><td>Cracked</td><td>Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td><td>Structural</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr> <tr> <td>Bench</td><td>Debris/deposition</td><td>Extreme: &gt;5 gal bucket</td><td>Maintenance</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr> <tr> <td>Channel</td><td>Debris/deposition</td><td>Extreme: &gt;5 gal bucket</td><td>Maintenance</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr> </table>																Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I													Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural													Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural													Bench	Debris/deposition	Extreme: >5 gal bucket	Maintenance													Channel	Debris/deposition	Extreme: >5 gal bucket	Maintenance												
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																												
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural																																																																																												
Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural																																																																																												
Bench	Debris/deposition	Extreme: >5 gal bucket	Maintenance																																																																																												
Channel	Debris/deposition	Extreme: >5 gal bucket	Maintenance																																																																																												
Cameron Run	000060SMH	X	1115	GIBBON ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		50	51	0		4																																																																																
<table border="1"> <tr> <td>Chimney/Shft</td><td>I/I evidence</td><td>Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td><td>I/I</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr> </table>																Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																												
Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I																																																																																												

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	000061CP	X	3865	EISENHOWER AV	Easement	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000061SMH	X	600	S PAYNE ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		51	52	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000062CP	X	3863	EISENHOWER AV	Easement	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000062SMH	X	1221	GIBBON ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		51	52	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000063CP	X	3869	EISENHOWER AV	Easement	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000063SMH	X	614	S PAYNE ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		56	57	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000064CB	X	3210	DUKE ST	Parking Lot	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		50	50	0		2
					Cover	Cracked / deteriorated	Min: <1/16" (2mm) width, tight		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000064CP	X	3869	EISENHOWER AV	Easement	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000064SMH	X	630	S PAYNE ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		59	60	0		4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Pipe Connection-1	Pipe cracked	Min: ~1/16" (2mm) width		Structural						
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000065CB	X	3209	COLVIN ST	Parking Lot	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1	Not Opened	0	0	0		0
Cameron Run	000065CP	X	3801	EISENHOWER AV	Easement	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000065SMH	X	1222	FRANKLIN ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		56	57	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000066SMH	X	732	S PAYNE ST	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		56	57	0		4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000068SMH	X	732	S PAYNE ST	Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000069SMH	X	840	S PAYNE ST	Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000071CB	X	3849	EISENHOWER AV	Curb/Gutter	03/19/2014	03/19/2014	Truck 1	1		0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000076SMH	X	910	S PAYNE ST	Light Highway Rural Streets	04/23/2014	04/23/2014	Truck 1	1		56	57	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Cameron Run	000077SMH	X	910	S PAYNE ST	Easement	04/23/2014	04/23/2014	Truck 1	1		22	22	0		2
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Cameron Run	000088SMH	X	631	S FAYETTE ST	Light Highway Rural Streets	04/23/2014	04/23/2014	Truck 1	1		61	62	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Pipe Connection-1	Pipe cracked	Min: ~1/16" (2mm) width		Structural						
					Pipe Connection-3	Mortar, "boot", or other seal	Min: ~1/16" (2mm) width cracks, separation, torn mat'l		Structural						
Cameron Run	000098IO	X	1200	DARTMOUTH RD	Easement	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		0	0	0		1
Cameron Run	000099IO	X	1200	DARTMOUTH RD	Easement	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		0	0	0		1
Cameron Run	000131IO	X	3640	WHEELER AV	Easement	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		0	0	0		1
Cameron Run	000146IO	X	129	S GORDON ST	Easement	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000147IO	X	238	S JENKINS ST	Easement	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000159IO	X	4400	VERMONT AV	Easement	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000169IO	X	1129	QUAKER HILL CT		<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1	Not found	0	0	0		1
Cameron Run	000170IO	X	1137	QUAKER HILL CT	Easement	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		28	29	0		1
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000171IO	X	1199	QUAKER HILL DR	Easement	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		0	0	0		1
Cameron Run	000173IO	X	3240	COLVIN ST	Easement	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000175IO	X	116	S QUAKER LA	Easement	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000177IO	X	1098	DARTMOUTH RD	Easement	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		0	0	0		1
Cameron Run	000178IO	X	4106	ORLEANS PL	Easement	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000192ND	X	309	PRINCETON BV		<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000195ND	X	303	PRINCETON BV		<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000196ND	X	301	PRINCETON BV		<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000197ND	X	303	PRINCETON BV		<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1	No Access	0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000202ND	X	400	PRINCETON BV		08/26/2013	08/26/2013	Truck 1	1	No Access	0	0	0		0
Cameron Run	000206ND	X	303	PRINCETON BV		08/26/2013	08/26/2013	Truck 1	1	No Access	0	0	0		0
Cameron Run	000220IN	X	919	CHURCH ST	Easement	04/18/2014	04/18/2014	Truck 1	1		37	38	0		4
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Cameron Run	000221IN	X	919	CHURCH ST	Easement	04/18/2014	04/18/2014	Truck 1	1		50	50	0		3
				Frame	Offset	Maj: 3" to 4" (7.5-10cm)			Structural						
Cameron Run	000222ND	X	4231	DUKE ST		03/06/2014	03/06/2014	Truck 1	1	No Access	0	0	0		0
Cameron Run	000229IO	X	4750	EISENHOWER AV	Easement	04/18/2014	04/18/2014	Truck 1	1		0	0	0		1
Cameron Run	000230CP	X	4400	WHEELER AV	Easement	03/21/2014	03/21/2014	Truck 1	1		0	0	0		1
Cameron Run	000230IO	X	4875	EISENHOWER AV	Easement	04/18/2014	04/18/2014	Truck 1	1		10	10	0		1
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Cameron Run	000231CP	X	4305	WHEELER AV	Easement	03/21/2014	03/21/2014	Truck 1	1	Not Opened	0	0	0		1
Cameron Run	000233IO	X	4601	EISENHOWER AV	Easement	09/11/2013	09/11/2013	Truck 1	1		0	0	0		1
Cameron Run	000234ND	X	4242	DUKE ST	Light Highway Rural Streets	03/05/2014	03/05/2014	Truck 1	1	No Access	0	0	0		0
Cameron Run	000238IO	X	4001	EISENHOWER AV		03/06/2014	03/06/2014	Truck 1	1	Not found	0	0	0		0
Cameron Run	000239IO	X	4349	EISENHOWER AV	Easement	02/28/2014	02/28/2014	Truck 1	1		0	0	0		1
Cameron Run	000241IO	X	4720	EISENHOWER AV		09/11/2013	09/11/2013	Truck 1	1	Not found	0	0	0		0
Cameron Run	000242IO	X	201	CLERMONT AV	Easement	02/28/2014	02/28/2014	Truck 1	1		0	0	0		1
Cameron Run	000245IO	X	4001	EISENHOWER AV	Easement	03/06/2014	03/06/2014	Truck 1	1		0	0	0		1
Cameron Run	000246IO	X	4101	EISENHOWER AV	Easement	03/06/2014	03/06/2014	Truck 1	1		0	0	0		1
Cameron Run	000248IO	X	3849	EISENHOWER AV	Easement	03/19/2014	03/19/2014	Truck 1	1		0	0	0		1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000258IO	X	3640	EISENHOWER AV	Easement	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000275ND	X	4227	VERMONT AV	Light Highway Rural Streets	<a href="#">03/05/2014</a>	<a href="#">03/05/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000291ND	X	136	CAMBRIDGE RD		<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000292ND	X	3060	DUKE ST		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000293ND	X	57	YALE DR		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000294ND	X	101	YALE DR		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000295ND	X	101	YALE DR		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000296ND	X	131	YALE DR		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000297ND	X	1139	QUAKER HILL CT		<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1	No Access	0	0	0		1
Cameron Run	000298ND	X	57	YALE DR		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000299ND	X	57	YALE DR		<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000300ND	X	57	YALE DR		<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1	No Access	0	0	0		1
Cameron Run	000302ND	X	116	S QUAKER LA		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000305ND	X	100	S QUAKER LA		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000309ND	X	3106	COLVIN ST		<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1	No Access	0	0	0		1
Cameron Run	000312ND	X	99	ARELL CT		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000314ND	X	3100	BUSINESS CENTER DR E		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000315ND	X	3208	COLVIN ST		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000320ND	X	3400	DUKE ST		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		1
Cameron Run	000323ND	X	1	ARELL CT		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000346IO	X	3234	COLVIN ST	Easement	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000436SMH	X	4070	TANEY AV	Easement	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		50	51	0		3

Chimney/Shaft Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Structural

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000442SMH	X	105	N GORDON ST	Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
Cameron Run	000442SMH	X	105	N GORDON ST		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	Not Opened	0	0	0		0
Cameron Run	000443SMH	X	104	N GLADDEN ST		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	Not Opened	0	0	0		0
Cameron Run	000445SMH	X	112	N GLADDEN ST	Light Highway Rural Streets	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		56	57	0		3
Cameron Run	000447ND	X	4750	EISENHOWER AV	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
Cameron Run	000447ND	X	4750	EISENHOWER AV		<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1	No Access	0	0	0		1
Cameron Run	000447SMH	X	152	N GLADDEN ST	Light Highway Rural Streets	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		29	29	0		2
Cameron Run	000452ND	X	4451	EISENHOWER AV	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
Cameron Run	000452ND	X	4451	EISENHOWER AV		<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1	No Access	0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes																																																																																																																																																	
Cameron Run	000453ND	X	4351	EISENHOWER AV		02/28/2014	02/28/2014	Truck 1	1	No Access	0	0	0		0																																																																																																																																																	
Cameron Run	000453SMH	X	100	N GORDON ST		03/07/2014	03/07/2014	Truck 1	1	Not Opened	0	0	0		0																																																																																																																																																	
Cameron Run	000454SMH	X	116	N GRAYSON ST	Light Highway Rural Streets	03/06/2014	03/06/2014	Truck 1	1		57	58	0		5																																																																																																																																																	
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Frame Base Seal</td> <td style="width: 10%;">I/I evidence</td> <td colspan="3">Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td> <td style="width: 10%;">I/I</td> <td colspan="10"></td> </tr> <tr> <td>Frame Base Seal</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, &lt;3/8" (1cm) etching</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Frame Base Seal</td> <td>Cracked / deteriorated</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shelf</td> <td>I/I evidence</td> <td colspan="3">Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shelf</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, etching</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shelf</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td colspan="3">Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, etching</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Pipe Connection-5</td> <td>I/I evidence</td> <td colspan="3">Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> </table>	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural											Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural											Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural											Pipe Connection-5	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I										
Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																											
Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural																																																																																																																																																											
Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																											
Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																											
Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																																																											
Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																											
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																											
Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																											
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																																																											
Pipe Connection-5	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																											
Cameron Run	000456SMH	X	90	N GORDON ST	Light Highway Rural Streets	03/06/2014	03/06/2014	Truck 1	1		61	61	0		2																																																																																																																																																	
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Pipe Connection-1</td> <td style="width: 10%;">I/I evidence</td> <td colspan="3">Extreme: &gt;10gpm, flow gushing</td> <td style="width: 10%;">I/I</td> <td colspan="10"></td> </tr> <tr> <td>Pipe Connection-2</td> <td>I/I evidence</td> <td colspan="3">Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> </table>	Pipe Connection-1	I/I evidence	Extreme: >10gpm, flow gushing			I/I											Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																										
Pipe Connection-1	I/I evidence	Extreme: >10gpm, flow gushing			I/I																																																																																																																																																											
Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																											
Cameron Run	000457SMH	X	4231	DUKE ST	Light Highway Rural Streets	03/06/2014	03/06/2014	Truck 1	1		60	61	0		5																																																																																																																																																	
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Frame Base Seal</td> <td style="width: 10%;">I/I evidence</td> <td colspan="3">Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td> <td style="width: 10%;">I/I</td> <td colspan="10"></td> </tr> <tr> <td>Frame Base Seal</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, &lt;3/8" (1cm) etching</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Frame Base Seal</td> <td>Cracked / deteriorated</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shelf</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shelf</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, etching</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shelf</td> <td>I/I evidence</td> <td colspan="3">Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> </table>	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural											Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural											Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																										
Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																											
Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural																																																																																																																																																											
Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																											
Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																											
Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																																																											
Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																											

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000458SMH	X	4231	DUKE ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I			56	58	0		4
					Chamber	Mortar missing	Min: <10% of area	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Pipe Connection-4	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Grade Ring	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Grade Ring	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Grade Ring	Offset	Min: 7/8" to 2" (2.5-5cm)	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Cameron Run	000459SMH	X	121	N FURMAN ST	Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural			50	51	0		4
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes																																																																																																															
Cameron Run	000461ND	X	3869	EISENHOWER AV		<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1	No Access	0	0	0		0																																																																																																															
Cameron Run	000461SMH	X	320	N JORDAN ST	Parking Lot	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		55	56	0		4																																																																																																															
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Frame Base Seal</td> <td style="width: 10%;">Corroded, pitted, spalled</td> <td colspan="3">Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)</td> <td colspan="2" style="width: 10%;">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Chimney/Shft</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, etching</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Chimney/Shft</td> <td>I/I evidence</td> <td colspan="3">Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td> <td colspan="2">I/I</td> <td colspan="9"></td> </tr> <tr> <td>Chimney/Shft</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td colspan="3">Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td> <td colspan="2">I/I</td> <td colspan="9"></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, etching</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> </table>															Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural											Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural											Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural											Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural										
Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural																																																																																																																									
Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																									
Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																									
Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																									
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																									
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																									
Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																									
Cameron Run	000462ND	X	3869	EISENHOWER AV		<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1	No Access	0	0	0		1																																																																																																															
Cameron Run	000462SMH	X	320	N JORDAN ST	Yard-Front	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		58	59	0		2																																																																																																															
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Frame</td> <td style="width: 10%;">Corroded, pitted, spalled</td> <td colspan="3">Mod: generally etching, 1/8" to 3/16" (3-5mm) depth</td> <td colspan="2" style="width: 10%;">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Frame Base Seal</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, &lt;3/8" (1cm) etching</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Frame Base Seal</td> <td>Cracked / deteriorated</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td colspan="3">Min: &lt;1/4gpm, staining, mineral deposits, flow weeping</td> <td colspan="2">I/I</td> <td colspan="9"></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, etching</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> </table>															Frame	Corroded, pitted, spalled	Mod: generally etching, 1/8" to 3/16" (3-5mm) depth			Structural											Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural											Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																										
Frame	Corroded, pitted, spalled	Mod: generally etching, 1/8" to 3/16" (3-5mm) depth			Structural																																																																																																																									
Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural																																																																																																																									
Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																									
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																									
Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																									
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																									
Cameron Run	000463ND	X	3869	EISENHOWER AV		<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1	No Access	0	0	0		0																																																																																																															
Cameron Run	000463SMH	X	320	N JORDAN ST	Easement	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		52	53	0		5																																																																																																															
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Frame Base Seal</td> <td style="width: 10%;">Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, &lt;3/8" (1cm) etching</td> <td colspan="2" style="width: 10%;">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Frame Base Seal</td> <td>Cracked / deteriorated</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Chimney/Shft</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> <tr> <td>Chimney/Shft</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: &lt;10% mat'l loss, etching</td> <td colspan="2">Structural</td> <td colspan="9"></td> </tr> </table>															Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural											Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																										
Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural																																																																																																																									
Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																									
Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																									
Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																									

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000464ND	X	4001	EISENHOWER AV		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000464SMH	X	4231	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		57	58	0		3
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	000465ND	X	4001	EISENHOWER AV		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000465SMH	X	4231	DUKE ST	Light Highway Rural Streets	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		63	63	15		2
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Channel	Debris/deposition	Mod: 1-3gal bucket	Maintenance							
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Cameron Run	000466ND	X	4001	EISENHOWER AV		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000466SMH	X	4233	DUKE ST	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		58	59	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural							
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Cameron Run	000467SMH	X	4233	DUKE ST	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		50	50	0		2
					Frame	Offset	Maj: 3" to 4" (7.5-10cm)	Structural							
Cameron Run	000468SMH	X	124	N GRAYSON ST		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	Not found	0	0	0		0
Cameron Run	000469ND	X	3800	DOMINION MILL DR		<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1	No Access	0	0	0		1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000470ND	X	3801	EISENHOWER AV		<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000470SMH	X	801	N HOWARD ST		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	Not found	0	0	0		0
Cameron Run	000471ND	X	3801	EISENHOWER AV		<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1	No Access	0	0	0		1
Cameron Run	000472ND	X	4001	EISENHOWER AV		<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000477SMH	X	1108	VASSAR RD	Light Highway Rural Streets	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		28	29	0		2
Cameron Run 000479SMH X 302						Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural				
						Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural				
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I				
						Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing			Structural				
						Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural				
Cameron Run	000480ND	X	2959	EISENHOWER AV		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		2
Cameron Run	000483ND	X	3697	EISENHOWER AV		<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1	Unsafe	0	0	0		1
Cameron Run	000485SMH	X	301	PRINCETON BV	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		64	64	0		3
Cameron Run 000486SMH X 301						Frame Base Seal	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching			Structural				
						Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural				
						Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I				
						Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural				
						Chimney/Shelf	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural				
Cameron Run	000486SMH	X	301	PRINCETON BV	Light Highway Rural Streets	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		51	52	0		2
Cameron Run 000486SMH X 301						Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I				
						Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural				
						Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural				

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shelf	Mortar missing	Min: <10% of area		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000489SMH	X	303	PRINCETON BV	Light Highway Rural Streets	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		53	54	0		4
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000500SMH	X	301	N QUAKER LA	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		29	29	0		2
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000561ND	X	3210	DUKE ST		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000597SMH	X	4213	DUKE ST	Light Highway Rural Streets	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		65	66	0		2
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
				Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
Cameron Run	000611IO	X	3000	EISENHOWER AV	Easement	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000612IO	X		EISENHOWER AV	Easement	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000613IO	X	3518	WHEELER AV	Easement	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000614IO	X		S Quaker Ln		<a href="#">05/20/2014</a>	<a href="#">05/20/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000615IO	X		S Quaker Ln		<a href="#">05/20/2014</a>	<a href="#">05/20/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	000618SMH	X	3649	WHEELER AV	Sidewalk	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		59	58	15		2
				Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural							
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
				Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Channel	Debris/deposition	Mod: 1-3gal bucket	Maintenanc e								

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000619SMH	X	3640	WHEELER AV	Sidewalk	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		50	51	0		3
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	000621SMH	X	3649	WHEELER AV	Sidewalk	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		53	54	0		3
					Frame	Offset	Mod: 2" to 3" (5-7.5cm)		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000622SMH	X		WHEELER AV	Parking Lot	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		53	54	0		3
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000634SMH	X	4242	DUKE ST	Light Highway Rural Streets	<a href="#">03/05/2014</a>	<a href="#">03/05/2014</a>	Truck 1	1		45	46	0		2
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Cameron Run	000638SMH	X	45	S GORDON ST	Light Highway Rural Streets	<a href="#">03/05/2014</a>	<a href="#">03/05/2014</a>	Truck 1	1		56	57	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Cameron Run	000641SMH	X	4141	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		4
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Cameron Run	000656ND	X	1500	EISENHOWER AV		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000657ND	X	910	S PAYNE ST		<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	000675SMH	X	4227	VERMONT AV	Light Highway Rural Streets	<a href="#">03/05/2014</a>	<a href="#">03/05/2014</a>	Truck 1	1		56	57	0		4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural							
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000676SMH	X	103	S GORDON ST	Light Highway Rural Streets	03/05/2014	03/05/2014	Truck 1	1		48	49	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000677SMH	X	113	S GORDON ST	Light Highway Rural Streets	03/05/2014	03/05/2014	Truck 1	1		48	49	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	000678SMH	X	129	S GORDON ST	Light Highway Rural Streets	02/28/2014	02/28/2014	Truck 1	1		48	49	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shelf	Cracked			Structural						
					Chimney/Shelf	Corroded, pitted, spalled			Structural						
Cameron Run	000684SMH	X	4306	VERMONT AV	Light Highway Rural Streets	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		59	60	0		3
					Frame Base Seal	I/I evidence			I/I						
					Frame Base Seal	Corroded, pitted, spalled			Structural						
					Frame Base Seal	Cracked / deteriorated			Structural						
					Chimney/Shelf	Corroded, pitted, spalled			Structural						
					Chimney/Shelf	Cracked			Structural						
					Chimney/Shelf	I/I evidence			I/I						
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	000685SMH	X	4313	VERMONT AV	Light Highway Rural Streets	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		59	61	0		4
					Frame Base Seal	I/I evidence			I/I						
					Frame Base Seal	Corroded, pitted, spalled			Structural						
					Frame Base Seal	Cracked / deteriorated			Structural						
					Chimney/Shelf	Cracked			Structural						
					Chimney/Shelf	Corroded, pitted, spalled			Structural						
					Chimney/Shelf	I/I evidence			I/I						
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	000692SMH	X	4400	VERMONT AV	Light Highway Rural Streets	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		59	60	0		4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run 000705SMH X 215				S JENKINS ST	Light Highway Rural Streets	03/21/2014	03/21/2014	Truck 1	1		58	57	17		2
Cameron Run 000706SMH X 225				S JENKINS ST	Light Highway Rural Streets	03/21/2014	03/21/2014	Truck 1	1		56	57	0		4
Cameron Run 000707SMH X 226				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Cameron Run 000707SMH X 226				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Cameron Run 000707SMH X 226				Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
Cameron Run 000707SMH X 226				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Cameron Run 000707SMH X 226				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural						
Cameron Run 000707SMH X 226				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
Cameron Run 000707SMH X 226				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
Cameron Run 000707SMH X 226				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Cameron Run 000707SMH X 226				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Cameron Run 000707SMH X 226				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Cameron Run 000707SMH X 226				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Cameron Run 000707SMH X 226				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Cameron Run 000707SMH X 226				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Cameron Run 000707SMH X 226				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Cameron Run 000707SMH X 226				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Cameron Run 000707SMH X 226				Bench	Debris/deposition	Mod: 1-3gal bucket			Maintenanc						
Cameron Run 000707SMH X 226				Channel	Debris/deposition	Min: <1gal bucket			Maintenanc						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	I/I evidence			I/I						
					Chimney/Shft	Cracked			Structural						
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	000707SMH	X	233	S JENKINS ST	Light Highway Rural Streets	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		56	57	0		3
					Frame Base Seal	I/I evidence			I/I						
					Frame Base Seal	Corroded, pitted, spalled			Structural						
					Frame Base Seal	Cracked / deteriorated			Structural						
					Chimney/Shft	Corroded, pitted, spalled			Structural						
					Chimney/Shft	Cracked			Structural						
					Chimney/Shft	I/I evidence			I/I						
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	000709SMH	X	4501	HOLMES RUN PY	Light Highway Rural Streets	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		56	57	0		4
					Frame Base Seal	I/I evidence			I/I						
					Frame Base Seal	Corroded, pitted, spalled			Structural						
					Frame Base Seal	Cracked / deteriorated			Structural						
					Chimney/Shft	I/I evidence			I/I						
					Chimney/Shft	Corroded, pitted, spalled			Structural						
					Chimney/Shft	Cracked			Structural						
					Chamber	I/I evidence			I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
Cameron Run	000710SMH	X	4501	HOLMES RUN PY	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
					CAMBRIDGE RD	Easement	04/18/2014	04/18/2014	Truck 1							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
Cameron Run	000793SMH	X	130	CAMBRIDGE RD	Light Highway Rural Streets	09/03/2013	09/03/2013	Truck 1	Structural						2	
Cameron Run	000794SMH	X	170	CAMBRIDGE RD	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching									
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
					Chimney/Shft	Mortar missing	Min: <10% of area									
					Chimney/Shft	Bricks displaced or missing	Min: <5% of area									
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						
Cameron Run	000795SMH	X	199	ELLSWORTH ST	Light Highway Rural Streets	09/03/2013	09/03/2013	Truck 1	1		63	65	0		4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000796SMH	X	199	ELLSWORTH ST	Light Highway Rural Streets	09/03/2013	09/03/2013	Truck 1	1		51	49	15		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000797SMH	X	138	CAMBRIDGE RD	Light Highway Rural Streets	09/03/2013	09/03/2013	Truck 1	1		68	69	5		3
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chimney/Shelf	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
				Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Bench	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
				Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Channel	Debris/deposition	Min: <1gal bucket		Maintenance							
Cameron Run	000798SMH	X	138	CAMBRIDGE RD	Light Highway Rural Streets	09/03/2013	09/03/2013	Truck 1	1		65	66	0		3
				Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000799SMH	X	136	CAMBRIDGE RD	Light Highway Rural Streets	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		64	64	5		3
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Bench	Debris/deposition	Mod: 1-3gal bucket		Maintenanc						
					Bench	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000801SMH	X	126	CAMBRIDGE RD	Easement	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	000802SMH	X	57	YALE DR		<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1	Not found	0	0	0		0
Cameron Run	000805SMH	X	3023	DUKE ST	Easement	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		15	15	0		2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000806SMH	X	3060	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		66	67	0		4
					Frame	Offset	Maj: 3" to 4" (7.5-10cm)		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	000809SMH	X	3023	DUKE ST	Light Highway Rural Streets	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000810SMH	X	218	ELSWORTH ST	Yard-Front	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		46	46	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	000811SMH	X	121	YALE DR	Driveway	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000819SMH	X	3101	COLVIN ST		<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1	Not Opened	0	0	0		0
Cameron Run	000826SMH	X	3214	COLVIN ST	Light Highway Rural Streets	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		52	51	5		3
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						
Cameron Run	000830SMH	X	57	YALE DR		09/03/2013	09/03/2013	Truck 1	1	Not found	0	0	0		0
Cameron Run	000831SMH	X	3101	COLVIN ST		03/28/2014	03/28/2014	Truck 1	1	Not found	0	0	0		0
Cameron Run	000834SMH	X	116	S QUAKER LA		03/28/2014	03/28/2014	Truck 1	1	Not found	0	0	0		0
Cameron Run	000835SMH	X	3023	DUKE ST	Sidewalk	04/18/2014	04/18/2014	Truck 1	1		37	38	0		3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000836SMH	X	3060	DUKE ST	Main Highway Suburban	04/23/2014	04/23/2014	Truck 1	1		50	51	0		3
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000837SMH	X	3240	DUKE ST		04/23/2014	04/23/2014	Truck 1	1	Not found	0	0	0		0
Cameron Run	000838SMH	X	3260	DUKE ST	Light Highway Rural Streets	04/23/2014	04/23/2014	Truck 1	1		56	57	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Cameron Run	000840SMH	X	11	N QUAKER LA	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		59	60	0		5
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Pipe Connection-5	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Cameron Run	000841SMH	X	3210	DUKE ST	Driveway	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		50	51	0		3
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000842SMH	X	3106	COLVIN ST	Light Highway Rural Streets	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		52	51	5		2
					Chimney/Shft	I/I evidence			I/I						
					Chimney/Shft	Cracked			Structural						
					Chimney/Shft	Corroded, pitted, spalled			Structural						
					Chamber	I/I evidence			I/I						
					Chamber	Cracked			Structural						
					Chamber	Corroded, pitted, spalled			Structural						
					Channel	Debris/deposition			Maintenance						
Cameron Run	000844SMH	X	3060	DUKE ST	Sidewalk	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		56	57	0		5
					Frame Base Seal	Corroded, pitted, spalled			Structural						
					Frame Base Seal	Cracked / deteriorated			Structural						
					Frame Base Seal	I/I evidence			I/I						
					Chimney/Shft	I/I evidence			I/I						
					Chimney/Shft	Cracked			Structural						
					Chimney/Shft	Corroded, pitted, spalled			Structural						
					Chamber	I/I evidence			I/I						
					Chamber	Cracked			Structural						
					Chamber	Corroded, pitted, spalled			Structural						
Cameron Run	000846SMH	X	116	S QUAKER LA	Light Highway Rural Streets	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		72	51	50		3
					Chimney/Shft	I/I evidence			I/I						
					Chimney/Shft	Corroded, pitted, spalled			Structural						
					Chimney/Shft	Cracked			Structural						
					Chamber	I/I evidence			I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
Cameron Run	000848SMH	X	116	S QUAKER LA	Parking Lot	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		72	51	50		4
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
Cameron Run	000849SMH	X	3200	COLVIN ST	Parking Lot	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		72	51	50		5
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
Cameron Run	000850SMH	X	201	N QUAKER LA	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		56	57	0		4
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000851SMH	X	210	N QUAKER LA	Light Highway Rural Streets	04/23/2014	04/23/2014	Truck 1	1		56	57	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000852SMH	X	202	N QUAKER LA	Light Highway Rural Streets	04/23/2014	04/23/2014	Truck 1	1	Not Opened	50	50	0		0
					Cover	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width		Structural						
Cameron Run	000853SMH	X	101	N QUAKER LA	Light Highway Rural Streets	04/23/2014	04/23/2014	Truck 1	1		56	57	0		4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	000854SMH	X	51	ARELL CT	Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Cameron Run	000855SMH	X	11	N QUAKER LA	Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Pipe Connection-2	Pipe cracked	Min: ~1/16" (2mm) width	Structural							
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Pipe Connection-4	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000856SMH	X	3518	WHEELER AV	Parking Lot	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		61	63	0		4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Grade Ring	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Grade Ring	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Grade Ring	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000857SMH	X	3400	DUKE ST	Parking Lot	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		59	59	0		4
					Frame	Offset	Mod: 2" to 3" (5-7.5cm)		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Pipe Connection-3	Pipe cracked	Min: ~1/16" (2mm) width		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Pipe Connection-3	I/I evidence				I/I						
Cameron Run	000858SMH	X	3400	DUKE ST	Driveway	03/28/2014	03/28/2014	Truck 1	1		50	51	0		3
				Chimney/Shft	I/I evidence				I/I						
				Chimney/Shft	Cracked				Structural						
				Chimney/Shft	Corroded, pitted, spalled				Structural						
				Chamber	I/I evidence				I/I						
				Chamber	Corroded, pitted, spalled				Structural						
				Chamber	Cracked				Structural						
Cameron Run	000860SMH	X	3400	DUKE ST	Light Highway Rural Streets	04/23/2014	04/23/2014	Truck 1	1		57	58	0		4
				Frame Base Seal	Cracked / deteriorated				Structural						
				Frame Base Seal	I/I evidence				I/I						
				Frame Base Seal	Corroded, pitted, spalled				Structural						
				Chimney/Shft	Cracked				Structural						
				Chimney/Shft	I/I evidence				I/I						
				Chimney/Shft	Corroded, pitted, spalled				Structural						
				Chamber	Cracked				Structural						
				Chamber	Corroded, pitted, spalled				Structural						
				Chamber	I/I evidence				I/I						
				Pipe Connection-3	I/I evidence				I/I						
Cameron Run	000861SMH	X	1	ARELL CT	Easement	03/28/2014	03/28/2014	Truck 1	1		47	43	15		3
				Chimney/Shft	I/I evidence				I/I						
				Chimney/Shft	Corroded, pitted, spalled				Structural						
				Chamber	I/I evidence				I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance						
Cameron Run	000866SMH	X	11	N QUAKER LA	Light Highway Rural Streets	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		29	29	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	000867SMH	X	3518	WHEELER AV		<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1	Not found	0	0	0		0
Cameron Run	000868SMH	X	1223	QUAKER HILL DR	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		47	48	0		2
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	000869SMH	X	1215	QUAKER HILL DR	Yard-Front	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		42	43	0		4
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	000870SMH	X	1202	DARTMOUTH RD	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		56	57	0		2
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	000871SMH	X	35	ARELL CT	Easement	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		0	0	0		3
Cameron Run	000907SMH	X	3208	COLVIN ST	Parking Lot	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		50	51	0		2
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001155IN	X	309	PRINCETON BV	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		50	50	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
Cameron Run	001162IN	X	1111	TRINITY DR	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		50	50	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
Cameron Run	001175SMH	X	4750	EISENHOWER AV	Parking Lot	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		52	53	0		2
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Cameron Run	001176SMH	X		4601	EISENHOWER AV	Parking Lot	09/11/2013	09/11/2013	Truck 1	1		60	60	5		2
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Channel	Debris/deposition	Min: <1gal bucket		Maintenanc e							
Cameron Run	001177SMH	X		4601	EISENHOWER AV	Sidewalk	09/11/2013	09/11/2013	Truck 1	1		61	62	0		5
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Cameron Run	001178SMH	X	4601	EISENHOWER AV	Parking Lot	09/11/2013	09/11/2013	Truck 1	1		62	62	5		3
				Frame	Offset	Mod: 2" to 3" (5-7.5cm)			Structural						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Channel	Debris/deposition	Min: <1gal bucket			Maintenance						
Cameron Run	001179SMH	X	4601	EISENHOWER AV	Parking Lot	09/11/2013	09/11/2013	Truck 1	1		72	73	0		3
				Frame	Offset	Maj: 3" to 4" (7.5-10cm)			Structural						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001180SMH	X	4351	EISENHOWER AV	Light Highway Rural Streets	02/28/2014	02/28/2014	Truck 1	1		54	55	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001181IN	X	301	PRINCETON BV	Sidewalk	08/26/2013	08/26/2013	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001181SMH	X	4601	EISENHOWER AV	Light Highway Rural Streets	02/28/2014	02/28/2014	Truck 1	1		51	52	0		4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	001182SMH	X	4101	EISENHOWER AV	Yard-Front	03/06/2014	03/06/2014	Truck 1	1		47	48	0		3
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Cameron Run	001184IN	X		DARTMOUTH	Sidewalk	08/26/2013	08/26/2013	Truck 1	1		5	5	0		3
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
Cameron Run	001185IN	X	1200	DARTMOUTH RD	Easement	08/26/2013	08/26/2013	Truck 1	1		0	0	0		2
Cameron Run	001186SMH	X	4700	EISENHOWER AV	Parking Lot	09/11/2013	09/11/2013	Truck 1	1		45	46	0		4
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Cameron Run	001187SMH	X	4700	EISENHOWER AV	Parking Lot	02/28/2014	02/28/2014	Truck 1	1		37	38	0		3
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Cameron Run	001189SMH	X	4701	EISENHOWER AV	Parking Lot	02/28/2014	02/28/2014	Truck 1	1		43	44	0		3
				Frame	Offset	Min: 7/8" to 2" (2.5-5cm)			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked			Structural						
Cameron Run	001190SMH	X	4101	EISENHOWER AV	Driveway	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		3
Cameron Run	001191IN	X	400	PRINCETON BV	Easement	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		45	46	0		2
					Frame Base Seal	Cracked / deteriorated			Structural						
					Frame Base Seal	Corroded, pitted, spalled			Structural						
					Chamber	I/I evidence			I/I						
					Chamber	Cracked			Structural						
					Chamber	Corroded, pitted, spalled			Structural						
Cameron Run	001191SMH	X	4101	EISENHOWER AV	Driveway	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		3
Cameron Run	001192IN	X	1205	TRINITY DR	Sidewalk	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	001192SMH	X	4101	EISENHOWER AV	Easement	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		2
Cameron Run	001193SMH	X	3801	EISENHOWER AV	Light Highway Rural Streets	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		50	51	0		3
					Chimney/Shft	Cracked			Structural						
					Chimney/Shft	Corroded, pitted, spalled			Structural						
					Chimney/Shft	I/I evidence			I/I						
					Chamber	I/I evidence			I/I						
					Chamber	Cracked			Structural						
					Chamber	Corroded, pitted, spalled			Structural						
Cameron Run	001195IN	X	1205	TRINITY DR	Sidewalk	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		37	38	0		4
					Chamber	I/I evidence			I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001210SMH	X	2850	EISENHOWER AV	Light Highway Rural Streets	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		54	55	0		4
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	001211SMH	X	2850	EISENHOWER AV	Light Highway Rural Streets	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		50	51	0		3
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001212SMH	X	2930	EISENHOWER AV	Light Highway Rural Streets	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		50	51	0		4
					Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shelf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001213SMH	X	2950	EISENHOWER AV	Light Highway Rural Streets	04/18/2014	04/18/2014	Truck 1	1		50	51	0		4
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	001214SMH	X	3000	EISENHOWER AV	Light Highway Rural Streets	04/18/2014	04/18/2014	Truck 1	1		50	51	0		3
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001215SMH	X	3000	EISENHOWER AV	Light Highway Rural Streets	04/18/2014	04/18/2014	Truck 1	1		50	51	0		5
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	001243IN	X	1102	JANNEYS LA	Sidewalk	03/19/2014	03/19/2014	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001244IN	X	1101	JANNEYS LA	Sidewalk	03/19/2014	03/19/2014	Truck 1	1		28	29	0		3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001246IN	X	1102	JANNEYS LA	Curb/Gutter	03/19/2014	03/19/2014	Truck 1	1		48	49	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Cameron Run	001248IN	X	1102	JANNEYS LA	Yard-Front	03/19/2014	03/19/2014	Truck 1	1		0	0	0		2
Cameron Run	001249IN	X	1105	VASSAR RD	Yard-Back	03/19/2014	03/19/2014	Truck 1	1		0	0	0		2
Cameron Run	001250IN	X	1207	TRINITY DR	Yard-Back	03/19/2014	03/19/2014	Truck 1	1		0	0	0		1
Cameron Run	001251IN	X	306	PRINCETON BV	Yard-Back	03/19/2014	03/19/2014	Truck 1	1		44	45	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Cameron Run	001380IN	X	1000	ST STEPHENS RD	Easement	03/06/2014	03/06/2014	Truck 1	1		58	60	0		3
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	001381IN	X	4004	FT WORTH AV	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	I/I	I/I evidence	50	50	0	2	
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Cameron Run	001382IN	X	1000	ST STEPHENS RD	Easement	03/06/2014	03/06/2014	Truck 1	1	I/I	46	47	0	3	
Cameron Run	001434IN	X	4071	TANEY AV	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	I/I	I/I evidence	45	46	0	2	
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	Structural							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
					Pipe Connection-2	Pipe cracked	Min: ~1/16" (2mm) width	Structural							
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked			Structural						
Cameron Run	001481IN	X	4213	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence			I/I						
					Chamber	Cracked			Structural						
					Chamber	Corroded, pitted, spalled			Structural						
Cameron Run	001493IN	X	4149	TANEY AV	Easement	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Cracked			Structural						
					Chamber	Corroded, pitted, spalled			Structural						
Cameron Run	001494IN	X	4149	TANEY AV	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	001495IN	X	320	N JORDAN ST	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		42	43	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
					Pipe Connection-1	I/I evidence			I/I						
Cameron Run	001496IN	X		DUKE ST.	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		50	50	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	001497IN	X	4233	DUKE ST	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		46	46	0		3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001498IN	X	112	N GORDON ST	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		42	42	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001500IN	X	212	N GORDON ST	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		51	51	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Pipe Connection-1	Pipe cracked	Maj: 3/16"-1/4" (5-6mm) width		Structural						
Cameron Run	001501IN	X	4233	DUKE ST	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		53	50	15		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenanc e						
					Pipe Connection-3	Pipe cracked	Maj: 3/16"-1/4" (5-6mm) width		Structural						
Cameron Run	001504IN	X	1000	ST STEPHENS RD	Easement	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1	No Access	0	0	0		0
Cameron Run	001505IN	X	1000	ST STEPHENS RD	Easement	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		44	45	0		2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Cameron Run	001506IN	X	4073	TANEY AV	Easement	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		51	52	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Cameron Run	001840IN	X	3649	WHEELER AV	Sidewalk	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		48	49	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Cameron Run	001841IN	X	3640	WHEELER AV	Sidewalk	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		42	42	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	001846IN	X	3649	WHEELER AV	Sidewalk	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		61	62	0		4
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
Cameron Run					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Bench	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
					Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Channel	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
					Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
Cameron Run	001849IN	X	3655	WHEELER AV	Sidewalk	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		20	20	0		2	
Cameron Run					Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Frame Base Seal	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching		Structural							
					DUKE ST	Parking Lot	<a href="#">03/05/2014</a>	<a href="#">03/05/2014</a>	Truck 1	1		46	46	0		2
Cameron Run					DUKE ST	Parking Lot	<a href="#">03/05/2014</a>	<a href="#">03/05/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
Cameron Run	001901IN	X	4141	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		2	
Cameron Run					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		2
Cameron Run					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	002339IN	X	3518	WHEELER AV	Parking Lot	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		37	38	0		5
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002347IN	X	1304	DARTMOUTH RD	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		2
Cameron Run	002348IN	X	1238	DARTMOUTH RD	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002349IN	X	1235	QUAKER HILL DR	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		42	43	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Pipe Connection-2	Pipe cracked	Min: ~1/16" (2mm) width		Structural						
Cameron Run	002350IN	X	1215	QUAKER HILL DR	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		42	43	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	002354IN	X	1201	QUAKER HILL DR	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		2
Cameron Run	002375IN	X		CAMBRIDGE RD	Curb/Gutter	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002376IN	X	126	CAMBRIDGE RD	Sidewalk	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002384IN	X	199	YALE DR	Sidewalk	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002388IN	X	57	YALE DR	Easement	<a href="#">09/03/2013</a>	<a href="#">09/03/2013</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002395IN	X	2944	DUKE ST	Curb/Gutter	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002398IN	X	3012	DUKE ST	Sidewalk	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002403IN	X	101	YALE DR	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002406IN	X	1101	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		42	42	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002407IN	X	1101	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		0	0	0		1
Cameron Run	002408IN	X	1101	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		42	42	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002409IN	X	1119	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		42	42	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002410IN	X	218	ELLSWORTH ST	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		42	42	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	002411IN	X	1140	QUAKER HILL CT	Sidewalk	08/26/2013	08/26/2013	Truck 1	1		35	35	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002412IN	X	201	YALE DR	Sidewalk	03/06/2014	03/06/2014	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002414IN	X	125	YALE DR	Sidewalk	03/06/2014	03/06/2014	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002416IN	X	1140	QUAKER HILL CT	Parking Lot	08/26/2013	08/26/2013	Truck 1	1		42	42	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002417IN	X	1139	QUAKER HILL CT	Parking Lot	08/26/2013	08/26/2013	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002418IN	X	1129	QUAKER HILL CT	Parking Lot	08/26/2013	08/26/2013	Truck 1	1		42	38	5		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						
Cameron Run	002419IN	X	1139	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		26	26	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002420IN	X	1139	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		42	42	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002421IN	X	1139	QUAKER HILL CT	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		37	38	0		1
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002422IN	X	125	YALE DR	Parking Lot	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		2
Cameron Run	002424IN	X	1199	QUAKER HILL DR	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		42	42	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002427IN	X	1199	QUAKER HILL DR	Sidewalk	<a href="#">08/26/2013</a>	<a href="#">08/26/2013</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002433IN	X	3026	COLVIN ST	Sidewalk	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		51	52	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002435IN	X	3106	COLVIN ST	Sidewalk	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		35	0	35		3
					Channel	Debris/deposition	Maj: 3-5gal bucket		Maintenanc						
Cameron Run	002446IN	X	3209	COLVIN ST	Sidewalk	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002450IN	X	3240	COLVIN ST	Sidewalk	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		51	52	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002451IN	X	100	S QUAKER LA	Parking Lot	03/28/2014	03/28/2014	Truck 1	1		69	38	59		1
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
					Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
Cameron Run	002452IN	X	116	S QUAKER LA	Parking Lot	03/28/2014	03/28/2014	Truck 1	1		69	38	59		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Bench	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
					Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
Cameron Run	002454IN	X	3100	DUKE ST	Driveway	03/06/2014	03/06/2014	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002456IN	X	3110	DUKE ST	Parking Lot	03/06/2014	03/06/2014	Truck 1	1		28	29	0		3
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002457IN	X	3110	DUKE ST	Driveway	03/06/2014	03/06/2014	Truck 1	1		0	0	0		2
Cameron Run	002458IN	X	3110	DUKE ST	Sidewalk	03/06/2014	03/06/2014	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002459IN	X	3110	DUKE ST	Sidewalk	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		3
Cameron Run	002460IN	X	3110	DUKE ST	Parking Lot	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002461IN	X	3120	DUKE ST	Parking Lot	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002463IN	X	3120	DUKE ST	Parking Lot	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	002464IN	X	3127	DUKE ST	Parking Lot	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002468IN	X	3208	DUKE ST	Parking Lot	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		37	38	0		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	002469IN	X	3210	DUKE ST	Parking Lot	03/21/2014	03/21/2014	Truck 1	1		37	38	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	002470IN	X	3210	DUKE ST	Sidewalk	03/21/2014	03/21/2014	Truck 1	1		46	38	25		4
					Chamber	Cracked			Structural						
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Bench	Debris/deposition			Maintenanc						
					Channel	Debris/deposition			Maintenanc						
Cameron Run	002471IN	X	3125	DUKE ST	Sidewalk	03/21/2014	03/21/2014	Truck 1	1		45	38	17		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
					Bench	Debris/deposition			Maintenanc						
					Channel	Debris/deposition			Maintenanc						
Cameron Run	002472IN	X	3125	DUKE ST	Sidewalk	03/21/2014	03/21/2014	Truck 1	1		37	38	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	002473IN	X	3240	DUKE ST	Sidewalk	03/21/2014	03/21/2014	Truck 1	1		69	38	59		1
					Chamber	I/I evidence			I/I						
					Chamber	Cracked			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Bench	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
					Channel	Debris/deposition	Extreme: >5 gal bucket		Maintenance						
Cameron Run	002474IN	X	3260	DUKE ST	Sidewalk	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		37	38	0		4
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002483IN	X	3200	COLVIN ST	Parking Lot	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		59	38	43		1
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Bench	Debris/deposition	Mod: 1-3gal bucket		Maintenance						
					Channel	Debris/deposition	Maj: 3-5gal bucket		Maintenance						
Cameron Run	002484IN	X	3200	COLVIN ST	Parking Lot	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		0	0	0		1
Cameron Run	002507IN	X	3502	WHEELER AV	Parking Lot	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		37	38	0		4
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	002512IN	X	3540	WHEELER AV	Parking Lot	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		41	38	2		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Debris/deposition	Min: <1gal bucket		Maintenance						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	002515IN	X	3518	WHEELER AV	Easement	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		0	0	0		2
Cameron Run	002518IN	X	3518	WHEELER AV	Parking Lot	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		50	51	0		5
						Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural					
						Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural					
						Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I					
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I					
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural					
						Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural					
Cameron Run	002519IN	X	3518	WHEELER AV	Easement	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		0	0	0		2
Cameron Run	002520IN	X	3518	WHEELER AV		<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1	Not found	0	0	0		0
Cameron Run	002522IN	X	3400	DUKE ST	Easement	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		49	50	0		3
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I					
						Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural					
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural					
						Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I					
Cameron Run	002528IN	X	35	ARELL CT	Sidewalk	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		42	43	0		3
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I					
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural					
						Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural					
						Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I					
Cameron Run	002529IN	X	1	ARELL CT	Sidewalk	<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1		37	38	0		2
						Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I					
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked			Structural						
Cameron Run	002536IN	X	3449	DUKE ST	Light Highway Rural Streets	03/28/2014	03/28/2014	Truck 1	1		15	15	0		2
					Chamber	Corroded, pitted, spalled			Structural						
Cameron Run	002838IN	X		ORLEANS PL	Sidewalk	03/06/2014	03/06/2014	Truck 1	1		37	38	0		3
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	003540SMH	X	3000	BUSINESS CENTER DR	Light Highway Rural Streets	04/18/2014	04/18/2014	Truck 1	1		37	38	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	003610IN	X	4451	EISENHOWER AV	Sidewalk	02/28/2014	02/28/2014	Truck 1	1		45	46	0		3
					Frame Base Seal	Cracked / deteriorated			Structural						
					Frame Base Seal	Corroded, pitted, spalled			Structural						
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	003613IN	X	4351	EISENHOWER AV	Sidewalk	02/28/2014	02/28/2014	Truck 1	1		37	38	0		4
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	I/I evidence			I/I						
					Chamber	Cracked			Structural						
Cameron Run	003614IN	X	4351	EISENHOWER AV	Sidewalk	02/28/2014	02/28/2014	Truck 1	1		42	38	5		2
					Chamber	I/I evidence			I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						
Cameron Run	003617IN	X	4536	EISENHOWER AV	Sidewalk	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	003624IN	X	4536	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	<a href="#">09/11/2013</a>	Truck 1	1		50	51	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Pipe Connection-1	Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width		Structural						
					Pipe Connection-2	Pipe cracked	Min: ~1/16" (2mm) width		Structural						
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Cameron Run	003625IN	X	4536	EISENHOWER AV	Easement	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		44	45	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Cameron Run	003626IN	X	4536	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	<a href="#">09/11/2013</a>	Truck 1	1		42	38	5		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Debris/deposition	Mod: 1-3gal bucket		Maintenance						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	003627IN	X	4600	EISENHOWER AV	Easement	<a href="#">09/11/2013</a>	<a href="#">09/11/2013</a>	Truck 1	1		46	46	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Pipe Connection-2	Pipe cracked	Min: ~1/16" (2mm) width		Structural						
Cameron Run	003632IN	X	4600	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	<a href="#">09/11/2013</a>	Truck 1	1		20	20	0		2
					Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
Cameron Run	003633IN	X	4600	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	<a href="#">09/11/2013</a>	Truck 1	1		47	48	0		4
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	003634IN	X	4600	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	<a href="#">09/11/2013</a>	Truck 1	1		45	46	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	003653IN	X	4101	EISENHOWER AV	Yard-Front	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		2
Cameron Run	003654IN	X	4351	EISENHOWER AV	Easement	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		37	38	0		2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
Cameron Run	003656IN	X	4700	EISENHOWER AV	Parking Lot	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Cameron Run	003657IN	X		EISENHOWER AV	Parking Lot	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		0	0	0		4
Cameron Run	003659IN	X	4700	EISENHOWER AV	Easement	<a href="#">09/11/2013</a>	<a href="#">09/11/2013</a>	Truck 1	1		45	46	0		3
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Cameron Run	003667IN	X	4740	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	<a href="#">09/11/2013</a>	Truck 1	1		58	58	0		3
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural							
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	Structural							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
Cameron Run	003668IN	X		EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	<a href="#">09/11/2013</a>	Truck 1	1		42	38	5		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						
Cameron Run	003669IN	X	4701	EISENHOWER AV	Sidewalk	<a href="#">09/11/2013</a>	<a href="#">09/11/2013</a>	Truck 1	1		55	52	15		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance						
Cameron Run	003674IN	X	4701	EISENHOWER AV	Sidewalk	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		50	50	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
Cameron Run	003675IN	X	4701	EISENHOWER AV	Parking Lot	<a href="#">02/28/2014</a>	<a href="#">02/28/2014</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	003689IN	X	3869	EISENHOWER AV	Yard-Side	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		0	0	0		2
Cameron Run	003695IN	X	4001	EISENHOWER AV	Parking Lot	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		28	29	0		1
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	003696IN	X	4001	EISENHOWER AV	Parking Lot	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		28	29	0		2
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked			Structural						
Cameron Run	003714IN	X	4101	EISENHOWER AV	Easement	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		2
Cameron Run	003716IN	X	4101	EISENHOWER AV	Driveway	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Cracked			Structural						
					Chamber	Corroded, pitted, spalled			Structural						
Cameron Run	003717IN	X	3833	EISENHOWER AV	Sidewalk	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		26	26	0		3
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
Cameron Run	003721IN	X	3801	EISENHOWER AV	Sidewalk	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	003722IN	X		EISENHOWER AV	Sidewalk	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	003726IN	X	3833	EISENHOWER AV	Sidewalk	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence			I/I						
					Chamber	Corroded, pitted, spalled			Structural						
					Chamber	Cracked			Structural						
Cameron Run	003728IN	X	3849	EISENHOWER AV	Sidewalk	<a href="#">03/19/2014</a>	<a href="#">03/19/2014</a>	Truck 1	1		0	0	0		3
Cameron Run	003787IN	X	3697	EISENHOWER AV	Sidewalk	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		0	0	0		2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Cameron Run	003808IN	X	3640	EISENHOWER AV	Sidewalk	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	004097SMH	X	4214	DUKE ST	Easement	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	38	0		4
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
Cameron Run	004123SMH	X		DUKE ST.		<a href="#">07/10/2014</a>	<a href="#">07/10/2014</a>	Truck 1	1		0	0	0		0
Cameron Run	004458IN	X	3208	COLVIN ST	Curb/Gutter	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	004459IN	X	3208	COLVIN ST	Curb/Gutter	<a href="#">03/21/2014</a>	<a href="#">03/21/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Cameron Run	004460IN	X	3100	BUSINESS CENTER DR E		<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1	Not found	0	0	0		0
Cameron Run	004461IN	X	3200	COLVIN ST		<a href="#">03/28/2014</a>	<a href="#">03/28/2014</a>	Truck 1	1	Not found	0	0	0		0
Cameron Run	008949IN	X	3000	BUSINESS CENTER DR	Sidewalk	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		0	0	0		2
Cameron Run	008951IN	X	3000	BUSINESS CENTER DR	Curb/Gutter	<a href="#">04/18/2014</a>	<a href="#">04/18/2014</a>	Truck 1	1		37	38	0		2
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	Cracked				Structural						
Cameron Run	009266IN	X		DUKE ST.	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		28	29	0		2
				Chamber	Cracked				Structural						
				Chamber	Corroded, pitted, spalled				Structural						
Cameron Run	009267IN	X		GLADDEN ST.	Yard-Side	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		37	37	0		2
				Chimney/Shft	Cracked				Structural						
				Chimney/Shft	Corroded, pitted, spalled				Structural						
Cameron Run	009268IN	X		ORLEANS PL	Yard-Back	<a href="#">03/06/2014</a>	<a href="#">03/06/2014</a>	Truck 1	1		0	0	0		3
Cameron Run	009284IN	X		S PAYNE ST	Easement	<a href="#">04/23/2014</a>	<a href="#">04/23/2014</a>	Truck 1	1		53	54	0		2
				Chamber	Cracked				Structural						
				Chamber	Corroded, pitted, spalled				Structural						
				Chamber	I/I evidence				I/I						
				Bench	I/I evidence				I/I						
				Bench	Corroded, pitted, spalled				Structural						
				Bench	Cracked				Structural						



## **Appendix C – Summary of Structures Not Inspected**



Facility ID	Why Not Inspected
000175SMH	Not Inspected - Sealed Lid
002267SMH	Not Inspected - Sealed Lid
000177SMH	Not Inspected - Sealed Lid
003706IN	Not Inspected - Sealed Lid
008772IN	Not Inspected - Sealed Lid
000054ND	Not Inspected - Not found
000056ND	Not Inspected - Not found
000131ND	Not Inspected - Not found
000297CB	Not Inspected - Not found
000373SMH	Not Inspected - Not found
000476ND	Not Inspected - Not found
001187ND	Not Inspected - Not found
001257ND	Not Inspected - Not found
001355ND	Not Inspected - Not found
001360ND	Not Inspected - Not found
001371ND	Not Inspected - Not found
001405ND	Not Inspected - Not found
001406ND	Not Inspected - Not found
001418ND	Not Inspected - Not found
001854SMH	Not Inspected - Not found
002074SMH	Not Inspected - Not found
002075SMH	Not Inspected - Not found
002813SMH	Not Inspected - Not found
004038SMH	Not Inspected - Not found
004039SMH	Not Inspected - Not found
004046SMH	Not Inspected - Not found
004049SMH	Not Inspected - Not found
004051SMH	Not Inspected - Not found
009004IN	Not Inspected - Not found
002097SMH	Not Inspected - No Access
002100SMH	Not Inspected - No Access
006747IN	Not Inspected - No Access
000330IN	Not Inspected - No Access
002156SMH	Not Inspected - No Access
007115IN	Not Inspected - No Access
007123IN	Not Inspected - No Access
008508IN	Not Inspected - No Access
008509IN	Not Inspected - No Access
008510IN	Not Inspected - No Access
008723IN	Not Inspected - Debris
002832SMH	Not Inspected - D.N.E



## **Appendix D - Summary of Observed Pipe Defects**



# SCREAMTM Lamping - Summary of Observed Defects

## Alexandria - Cameron Run

Pipe	SCREAM Total Score	USMH Bldg	MH Street	Observed	Inventory	Maintenanc	Structural				
				Infiltration	Information	Debris	Crack				Open Joint
				Infiltration (Count)	General Remark (Count)	Debris (Length)	Crack Circumferential (Count)	Crack Longitudinal (Length)	Cracks Multiple (Count)	Cracks Multiple (Length)	Open Joint (Count)
001494IN-001495IN	13	4148	TANEY AV	1	0	0	0	0	0	0	0
002528IN-000860SMH	13	3400	DUKE ST	1	0	0	0	0	0	0	0
000840SMH-000866SMH	13	11	QUAKER LA	1	0	0	0	0	0	0	0
000855SMH-000840SMH	13	11	QUAKER LA	1	0	0	0	0	0	0	0
002350IN-002354IN	13	1201	QUAKER HILL DR	1	0	0	0	0	0	0	0
001480IN-000457SMH	13	4231	DUKE ST	1	0	0	0	0	0	0	0
000453SMH-000456SMH	13	91	GORDON ST	1	0	0	0	0	0	0	0
001424IN-000436SMH	13	4070	TANEY AV	1	0	0	0	0	0	0	0
000857SMH-002522IN	13	3400	DUKE ST	1	0	0	0	0	0	0	0
000454SMH-009267IN	13	116	GRAYSON ST	1	0	0	0	0	0	0	0
001175SMH-000230IO	20	4875	EISENHOWER AV	2	0	0	0	0	0	0	0
003627IN-003626IN	23	4600	EISENHOWER AV	0	0	0	0	0	1	0	0
002349IN-000868SMH	25	1223	QUAKER HILL DR	0	0	0	0	4	0	0	0
000088SMH-000064SMH	25	630	PAYNE ST	0	0	0	0	4	0	0	0
000597SMH-000457SMH	28	4231	DUKE ST	1	0	0	0	0	0	0	0
000456SMH-000457SMH	28	4231	DUKE ST	1	0	0	0	0	0	0	0
003626IN-003624IN	30	4536	EISENHOWER AV	0	0	0	0	0	0	0	1
000089SMH-000088SMH	33	631	FAYETTE ST	0	0	0	1	0	0	0	0
000429SMH-001382IN	33	4018	FT WORTH AV	0	0	0	1	0	0	0	0
000853SMH-000854SMH	40	51	ARELL CT	0	0	0	0	0	0	4	0
001501IN-000466SMH	40	108	GORDON ST	0	0	0	0	0	0	4	0
001495IN-001500IN	40	212	GORDON ST	0	0	0	0	0	0	4	0
000177IN-000064SMH	40	630	PAYNE ST	0	0	0	0	0	0	4	0
000846SMH-000614IO	45	116	QUAKER LA	0	0	4	0	0	0	0	0
002382ND-000615IO	45	116	QUAKER LA	0	0	4	0	0	0	0	0
Total				14	60	8	2	8	1	16	1